

Give All Information Completely
Make Required Affidavit
Mail or Deliver Report to:
Conservation Division
State Corporation Commission
800 Bittling Building
Wichita, Kansas

FORMATION PLUGGING RECORD

Strike out upper line
when reporting plugging
of formations.

NORTH

	X		

Locate well correctly on above
Section Plat

Stafford County. Sec. 32 Twp. 21 Rge. (E) 12 (W)
Location as "NE $\frac{1}{4}$ NW $\frac{1}{4}$ SW $\frac{1}{4}$ " or footage from lines. CE/2 NE/4 SW/4
Lease Owner Stanolind Oil and Gas Company
Lease Name G. W. Walker "B" Well No. 4
Office Address Box 1633, Oklahoma City, Oklahoma
Character of Well (completed as Oil, Gas or Dry Hole) Dry hole
Date well completed December 11 19 46
Application for plugging filed December 11 19 46
Application for plugging approved December 11 19 46
Plugging commenced December 11 19 46
Plugging completed December 12 19 46
Reason for abandonment of well or producing formation
Completed as a dry hole.
If a producing well is abandoned, date of last production 19
Was permission obtained from the Conservation Division or its agents before plugging was commenced? Yes

Name of Conservation Agent who supervised plugging of this well Mr. H. W. Kerr
Producing formation Arbuckle Depth to top 3630 Bottom 3661 Total Depth of Well 3661 Feet
Show depth and thickness of all water, oil and gas formations.


OIL, GAS OR WATER RECORDS

CASING RECORD

Formation	Content	From	To	Size	Put In	Pulled Out
Top Lansing		3287		8-5/8	676	None
Top Simpson		3570				
Arbuckle	Scattered oil stains	3630	3661			

Describe in detail the manner in which the well was plugged, indicating where the mud fluid was placed and the method or methods used in introducing it into the hold. If cement or other plugs were used, state the character of same and depth placed, from _____ feet to _____ feet for each plug set.

Plugged with Wood Plug 502' to 500'
15 sax cement 500' to 451'
Heavy mud 451' to 16'
Wood Plug 16' to 14'
Capped with 8 sax cement 14' to bottom of cellar

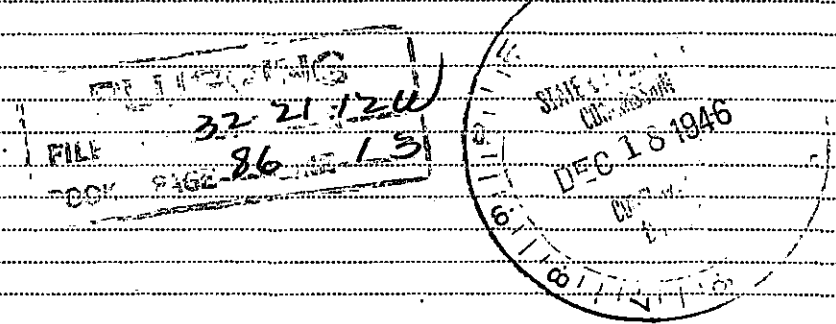

(If additional description is necessary, use BACK of this sheet)

Correspondence regarding this well should be addressed to Mr. T. L. Regan
Address Box 1633, Oklahoma City, Oklahoma

STATE OF Kansas, COUNTY OF Barton, ss.
H. G. Nething (employee of owner) or (owner or operator) of the above-described well,

being first duly sworn on oath, says: That I have knowledge of the facts, statements, and matters herein contained and the log of the above-described well as filed and that the same are true and correct. So help me God.

(Signature) H. G. Nething Field Supt.

Box 8, Ellinwood, Kansas (Address)

SUBSCRIBED AND SWORN to before me this 17 day of December, 19 46

My commission expires July, 1950 Notary Public.

FORMATION RECORD

DESCRIBE EACH FORMATION DRILLED. INDICATE THICKNESS, CONTENT AND WHETHER DRY, OR OIL, GAS, OR WATER BEARING.

FORMATION	TOP	BOTTOM	FORMATION	TOP	BOTTOM
Sand and Clay	0	100			
Sand	100	375			
Red Mud and Shells	375	662			
Anhydrite	662	685			
Shale and Shells	685	1180			
Salt	1180	1240			
Salt, Shale and Shells	1240	1475			
Lime and Shale	1475	2615			
Lime	2615	2669			
Lime and Shale	2669	2890			
Lime	2890	3200			
Shale	3200	3272			
Lime	3272	3510			
Lime and Shale	3510	3634			
Lime	3634	3661 TD			
Schlumberger Electric Log C TD		3644			
No show of oil					
Plugged and abandoned December 12, 1946					