

Cement Report

Customer <i>Stelbar</i>	Lease No.	Date <i>10/28/14</i>
Lease <i>Ellis</i>	Well # <i>1-12</i>	Service Receipt
Casing <i>5 1/2</i>	Depth <i>4781</i>	County <i>Scott</i> State <i>Ks</i>
Job Type <i>LS D.V.</i>	Formation	Legal Description

Pipe Data		Perforating Data		Cement Data
Casing size <i>5 1/2</i>	Tubing Size	Shots/Ft		Lead 1st stage
Depth <i>4485'</i>	Depth	From <i>D.V. @ 2365'</i>	To	<i>150 SK AA-2 @ 14.8#</i>
Volume <i>105.68</i>	Volume	From	To	<i>1.51 6.63</i>
Max Press	Max Press	From	To	Tail in 2nd stage
Well Connection <i>PC.</i>	Annulus Vol.	From	To	<i>400 SK A-Com @ 11.4#</i>
Plug Depth	Packer Depth	From	To	<i>90 SK P.P. @ 14.8#</i>



Time	Casing Pressure	Tubing Pressure	Bbls. Pumped	Rate	Service Log
01:30					on loc
02:30					RON F.E.
11:23	3000				Test Lines
11:25	200		12	6	Pump superflush
11:29	200		5	6	H2O spacer
11:31	230		0	6	Mix AA-2 @ 14.8#
11:50	0		40		Shot Down, Drop Plug, Washup
11:58	50		0	4.2	Start Disp.
12:13	210		50	7.5	on med
12:26	510-1400		106	-	Plug Down, Drop Bomb
12:43	1200-130		12	4	open Tool
12:49					Hook to Rig Circ 4 hrs
16:00					Plug Rat hole
16:17	140		0	6	Start Mixing @ 11.4#
16:40	190		210	5.4	on Tail @ 14.8#
16:45	0		21.5	0	Finished Mixing, Drop Plug, washup
16:53	70		0	5	Start Disp
17:04	140		46	3.5	slow Rate
17:07	550-1490		56	0	Plug Down, Tool shut
					Job Complete

Service Units	<i>78939</i>	<i>37253726</i>	<i>3046439724</i>	<i>2780819883</i>
Driver Names	<i>Chavez</i>	<i>G. Echevarria</i>	<i>Margarito</i>	<i>marco</i>

Ty Lund Customer Representative
 Jerry Bennett Station Manager
 Chad Ariz Cementer


STELBAR

ELLIS 1-12

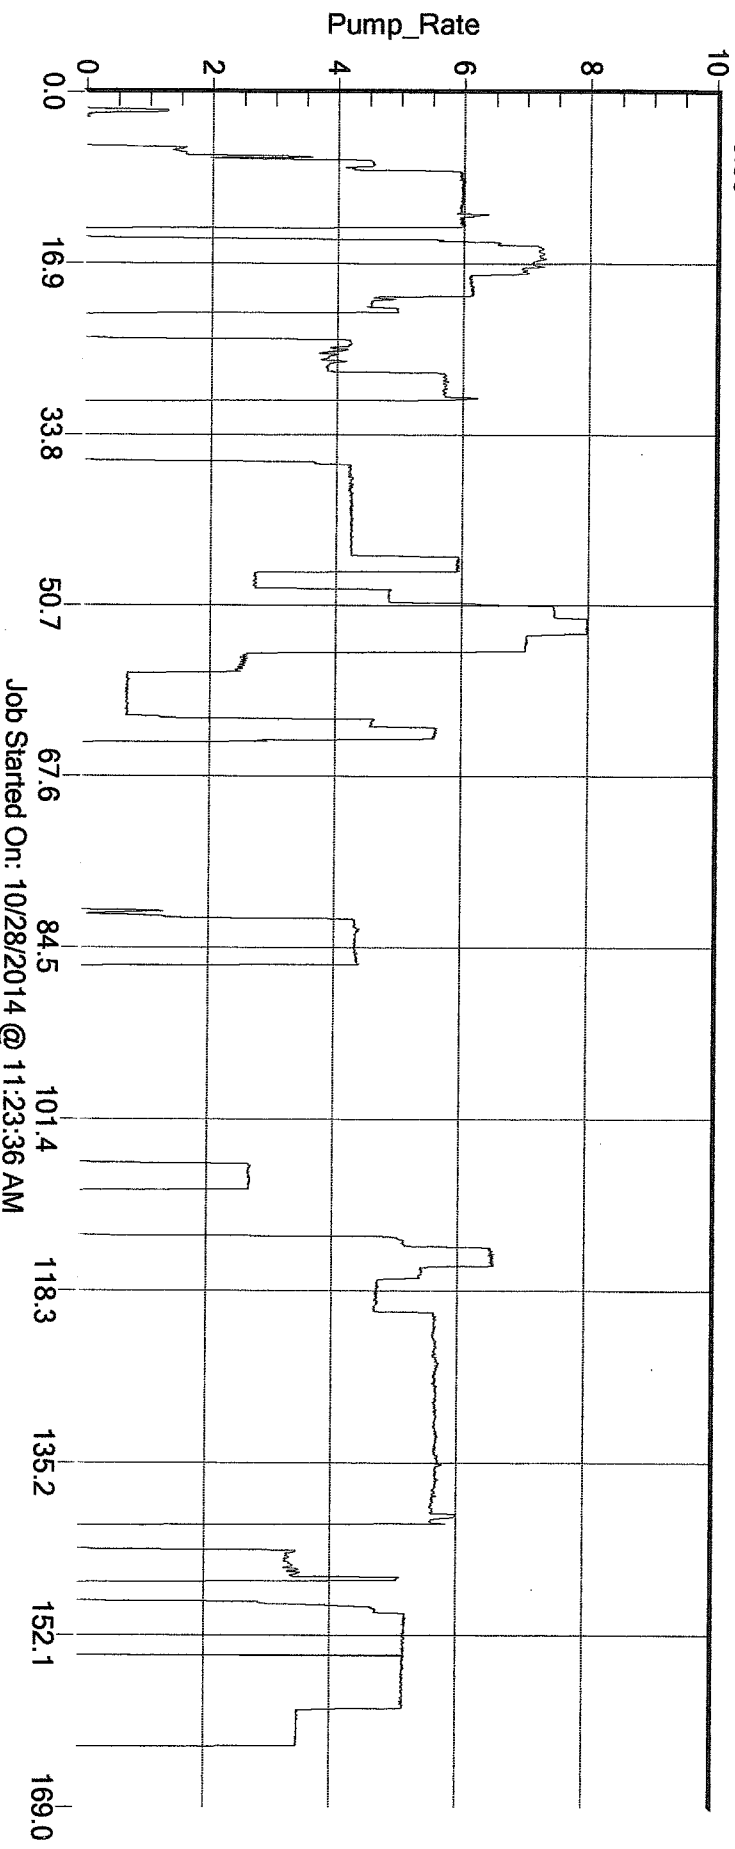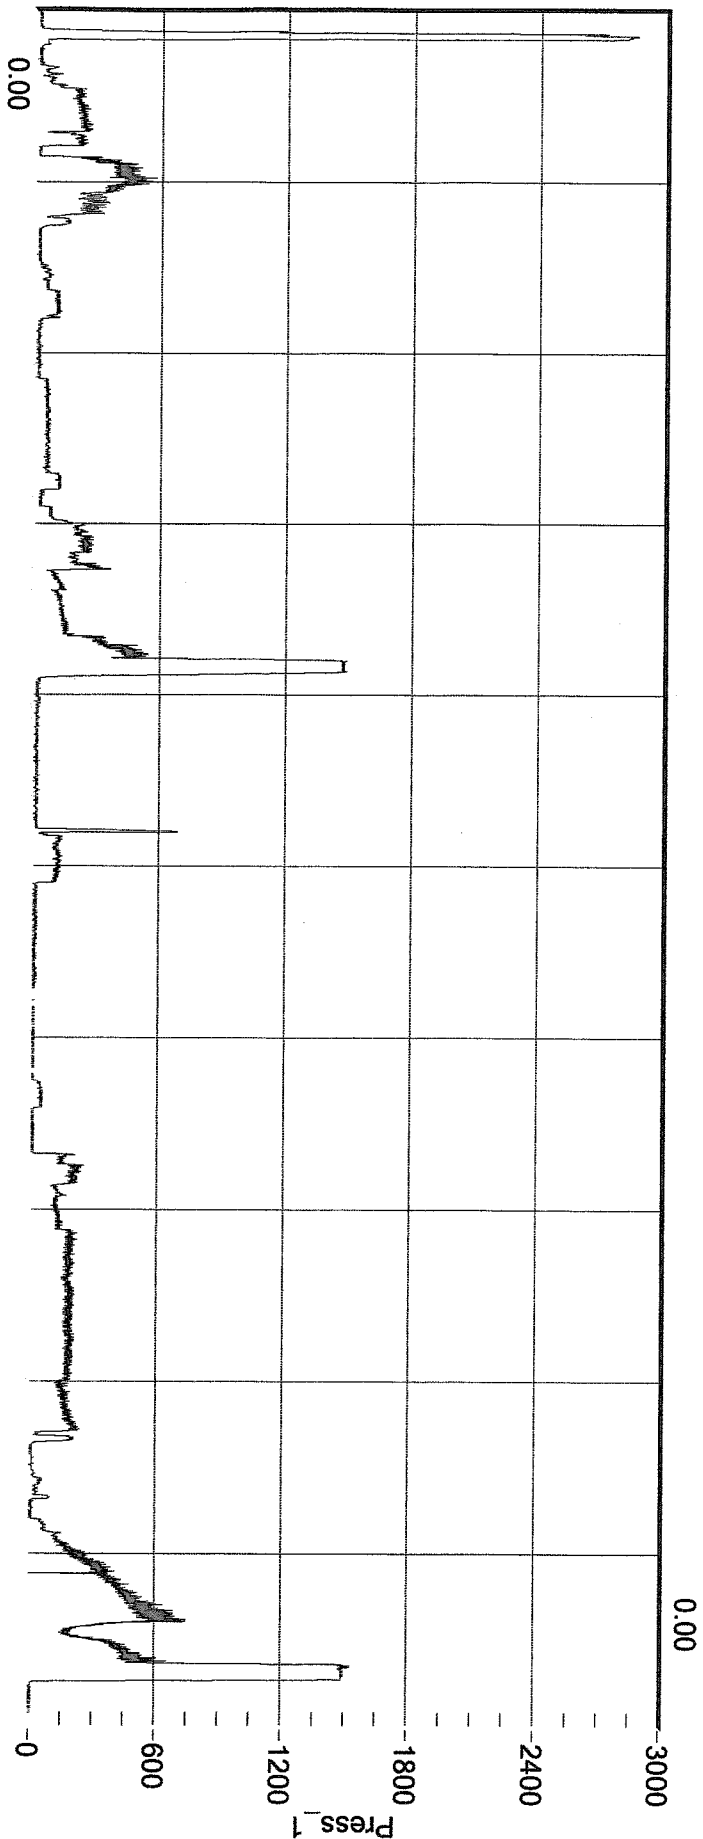

Job Started On: 10/28/2014 @ 11:23:36 AM

STELBAR
ELLIS 1-12

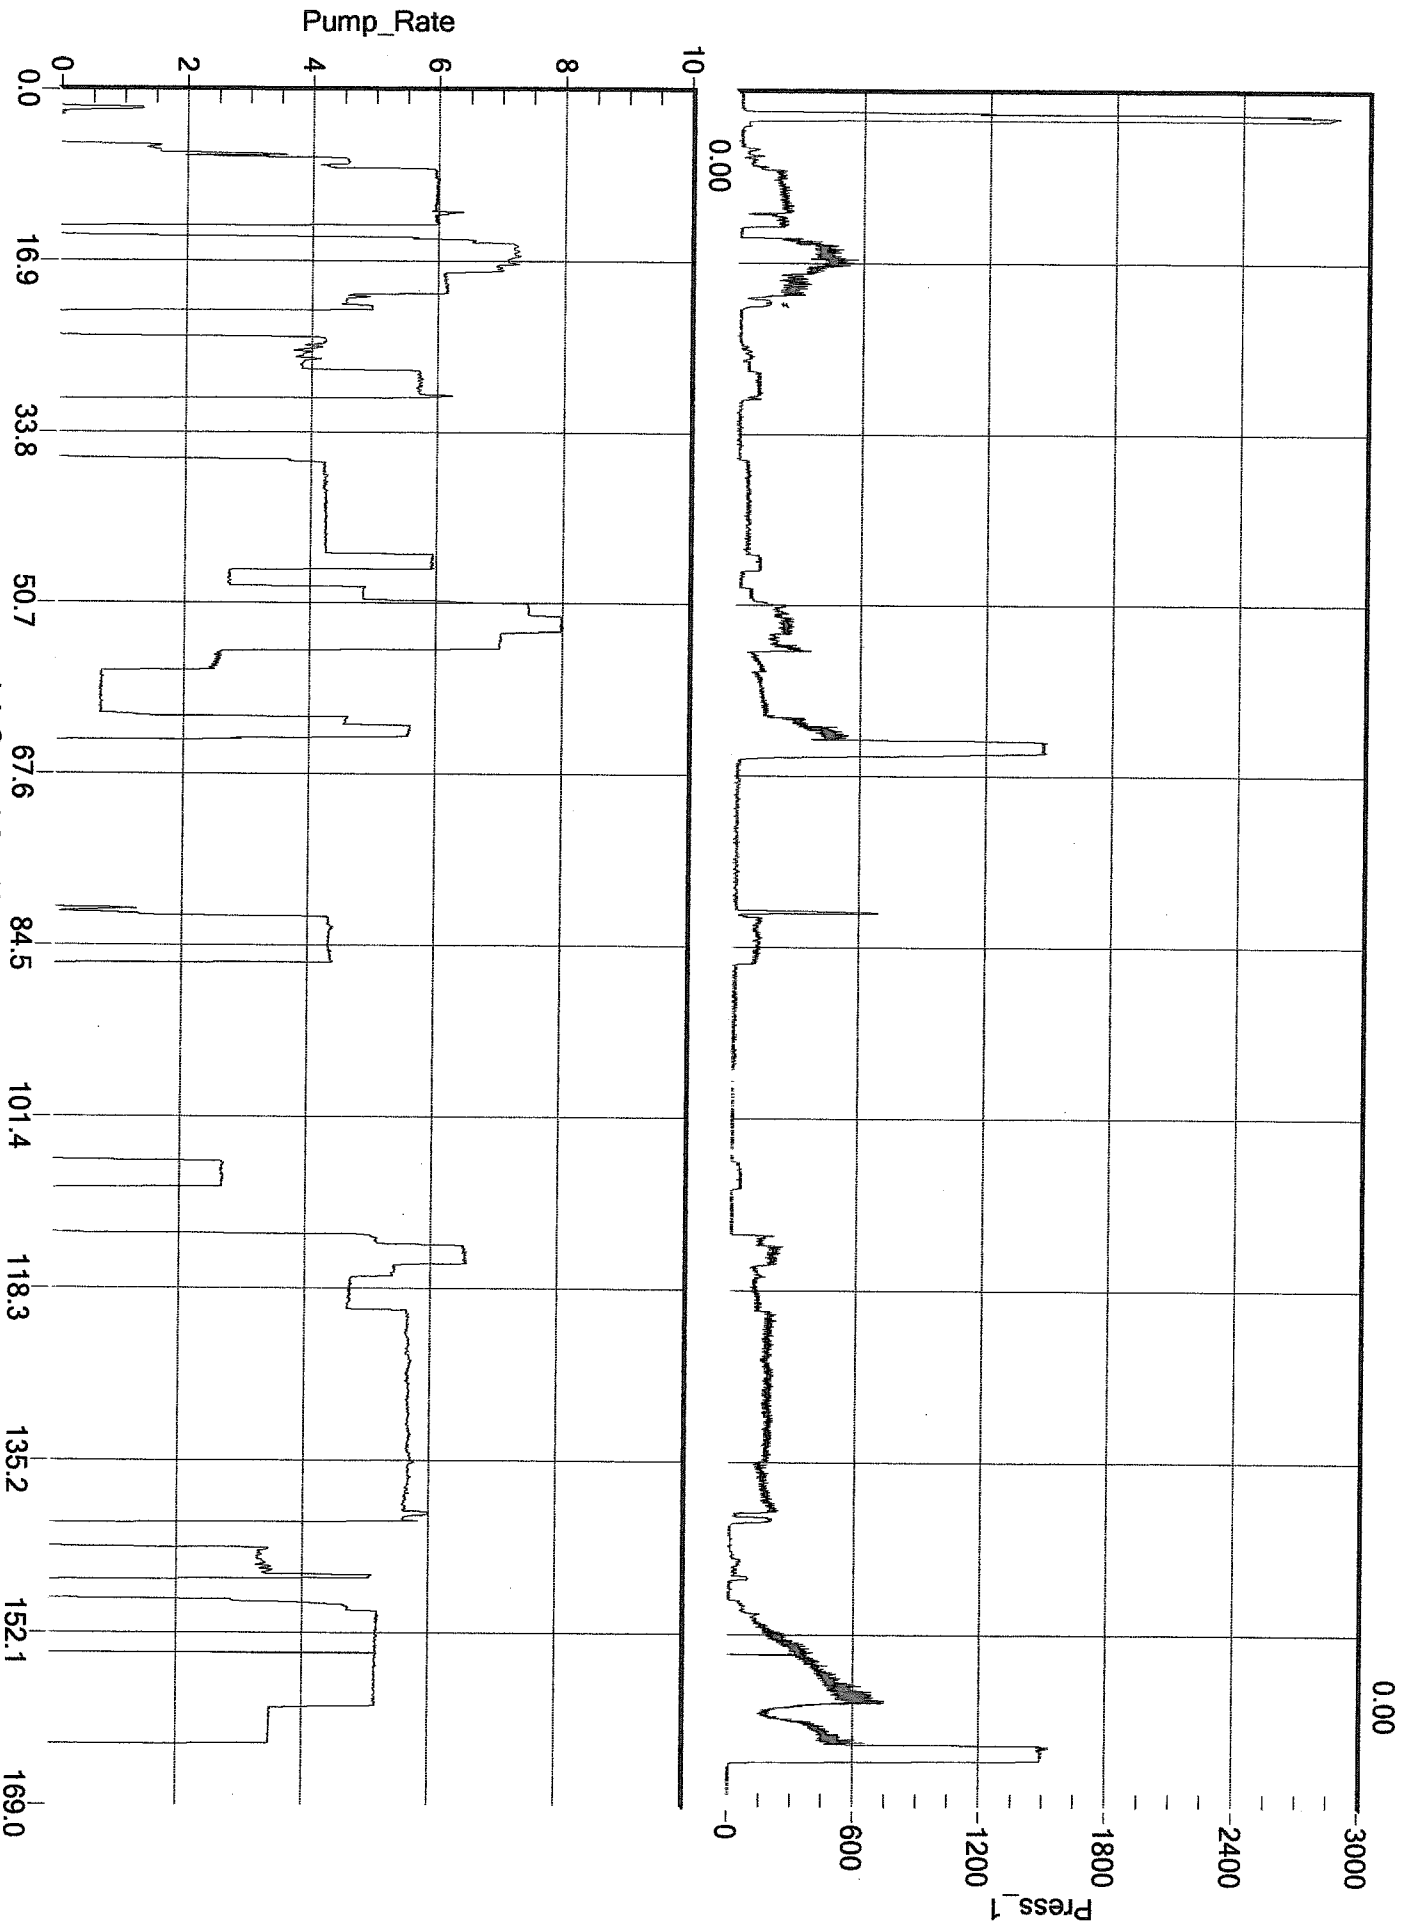

Job Started On: 10/28/2014 @ 11:23:36 AM