Customer Name SUEMAUR EXPLORATON
Well Name GODFREY 1-32
Job Type Surface

District Liberal
Supervisor ALDO ESPINOZA
Engineer




					THE PRINCE OF THE PARTY OF THE					19
										160
					188					17
					TOTAL PROPERTY.					16
THANKS										15
LEAVE LOCATION					The state of the s		CLEAR LOCATION		1140PM	14
HOLD CEMENT										13
LEAVE 85/8 SWEDGE AND 2" VALVE ON CASING TO										
RIG DOWN					73		RIG DOWN		1040PM	12
SHUTITIN					The same of the sa				1032PM	11
LEAVE 20 FT OF CEMENT ON PIPE 20 bbl's cement returns										10
17.5 BBL WATER DISPLACEMENT		17.5	ω	8.34	THE REAL PROPERTY AND ADDRESS OF THE PERSON NAMED IN COLUMN TWO IN COLUM					9
START DISPLACING			ω	8.34			DISPLACEMENT		1027PM	œ
275 SK/65 BBL SLURRY AT 14.8 #		65	ω	14.8			SLURRY		959PM	7
5 BBL WATER SPACER		5	ω	8.34	THE WASHINGTON		SPACER		957PM	6
SAFETY MEETING, PRESSURE TEST LINES	2000		0.2	8.34	53		SAFETY MEETING		940PM	5
RIG UP SUEDGE, BRAKE CIRCULATION					THE REAL PROPERTY.				Md0£6	4
CASING ON BOTTOM					HINTER STREET, SQUARE, STREET, SQUARE, STREET, SQUARE,				926PM	U
RIGUP					50		Rig Up	Operational	600PM	2
ON LOCATION		-	The second		48	Cement Pump Truck	Arrive on Location	Mobilization	10/26/2017 17:30	p=3
Commission	(psi)	(bbls)	(bpm)	(lb/gal)	Eventio	Equipment	Event	Category	Start Date/Time	Seq No.
	Pipe Pressure	No duind	Pump Kate	Density	-				ì	



Customer:	Suemaur Exploration & Production, LLC	
Date:	Thursday, October 26, 2017	
Well Name:	Godfrey # 1-32	
Well Location:	Hoxie Ks	
Supervisor:	Aldo Espinoza	

Equipment Operators: Cristian Camacho, Gerardo Burciaga

Performance		Custo	mer
Was the appearance of the personnel and equipment satisfactory?	Y	'es	No
Was the job performed in a professional manner?	Y	'es	No
Were the calculations prepared and explained properly?	Y	'es	No
Were the correct services dispatched to the job site?	Y	'es	No
Were the services performed as requested?	Y	'es	No
Did the job site environment remain unchanged?	Y	'es	No
Did the equipment perform in the manner expected?	Y	'es	No
Did the materials meet your expectations?	Υ	'es	No
Was the crew prepared for the job?	Y	'es	No
Was the crew prompt in the rig-up and actual job?	Y	'es	No
Were reasonable recommendations given, as requested?	Y	'es	No
Did the crew perform safely?	Y	'es	No
Was the job performed to your satisfaction?	Y	'es	No
Customer Signature:	•		
	Date:		
Additional Comments:			

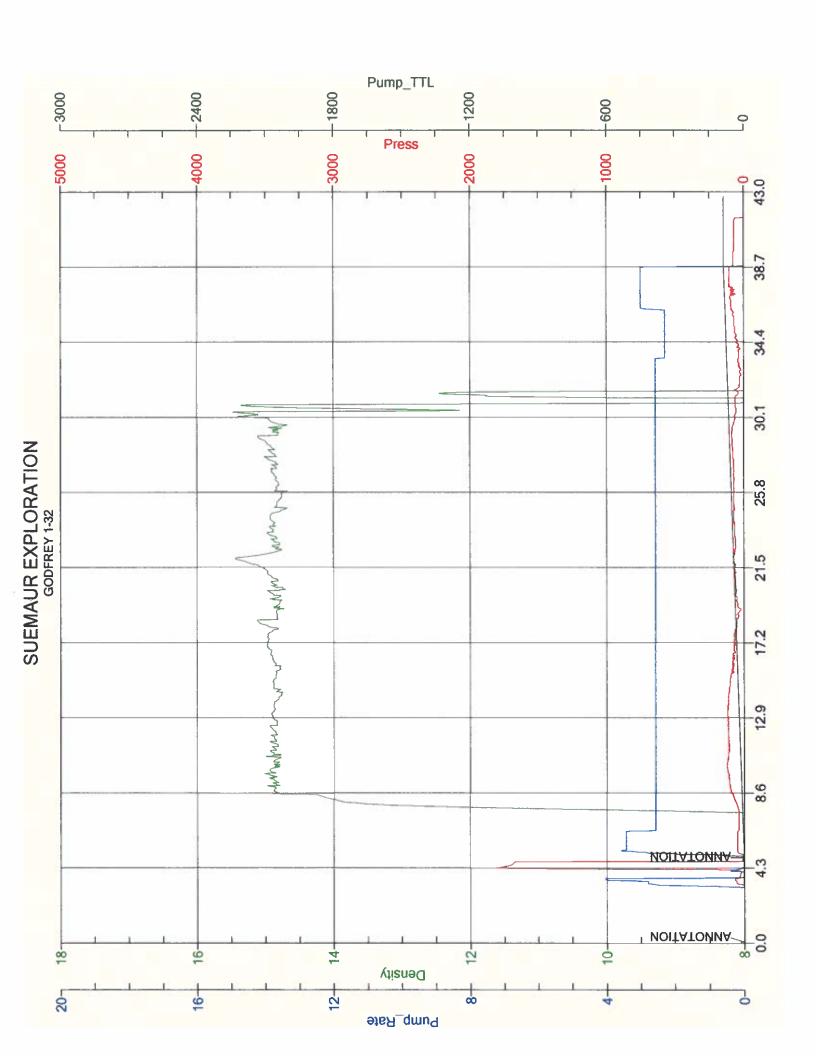



Company Name:	Suemaur Ex	ploration &	Production, LLC
Lease Name:	-	Godfrey # 1-	32
County	Sheridan	State	KS
Water Source:	Jierdan	TANK	
Submitted By:	Aldo Espinoza	Date:	10/26/2017
pH Level	7		Must be less than 8.5
Sulfates	400		Must be less than 1,000 PPM
Chlorides	0	<u>_</u>	Must be less than 3,000 PPM
Temperature	64		
COMMENTS			

Customer Signature

Thank You