


FARM Lindley

NO 1

COUNTY Butler

KANSAS

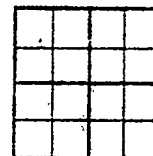

TOTAL DEPTH 2811'
 COMM Nov. 1922
 SHOT OR TREATED
 CONTRACTOR
 ISSUED

COMP 12-11-22

CASING

20		10	1050'
15	1/4"	8 1/4	2395'
12	1/2"	6	
13		5	

ELEVATION

PRODUCTION

Dry

lime	95	shale	1135
shale	108	lime	1145
lime	118	shale	1155
slate	128	shale, shells	1185
lime	142	shale	1215
red rock	152	lime	1235
lime	160	slate	1255
slate	170	lime	1265
sand	195	shale	1295
shale	240	lime	1345
lime	260	shale	1385
shale	270	lime	1400
lime	290	shale	1450
shale	295	lime	1550
lime	325	shale	1580
shale	345	sand	1630
lime	365	shale	1680
shale	375	lime	1700
lime brkn	405	shale	1800
shale	425	lime	1940
lime	435	shale	2100
shale	445	lime-3 EW 2140	2260
lime brkn	475	sdv shale	2280
shale	490	shale	2340
lime	495	lime	2345
shale	510	shale	2380
lime	515	sand, wtr HFW	2410
shale	530	shale	2450
lime brkn-4 EW	540	lime	2465
sand	550	shale	2575
shale	575	lime	2585
sand HFW	590	shale	2765
shale	605	lime Mississippi	2811
lime	610	Total Depth Wtr.	
red rock	620		
shale	640		
lime	645		
red rock	650		
shale	660	shale	1030
lime	689	lime	1050?
shale	740	shale	1050?
lime	745	lime	1065
shale	800	shale	1075
lime	840	2 EW	
shale	855	lime	1105
lime	930	shale	1115
shale	975	lime	1125
sand HFW	1000		

FIGURES INDICATE BOTTOM OF FORMATIONS

KC 2100
 1365
 -735

2765
 1365
 Miss -1400