

Company Excelsior Brick Co.

Farm Long

No. 1

36-28-14E
Sec. 36 T. 28 R. 14

Loc.

County Wilson

Total Depth 1430

Comm. 2-16-25

Comp. 3-17-25


Shot or Treated

Contractor Walter Fees

Issued

Casing

20 in.	10 in
15 1/2	8 1/4
12 1/2	6 5/8
13 3/8	5 3/16

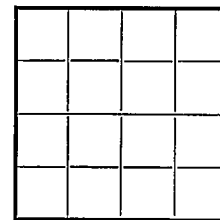

Elevation

Production

Figures Indicate Bottom of Formation

soil	3		
shale	17	sand	955
lime	35	shale	980
shale	70	shale, sdv.	1002
lime	78	sand	1027 gas
shale	82	shale	1032
lime	100	sand	1042
shale	180	shale	1061
lime	196	lime shale	1085
shale	241	" shale, sdv.	1088 oil & wtr.
lime	253	" shale	1251
shale	275	shale, green	1259
lime	380	lime	1270
shale	382	wtr. @ 325	
sand	415	shale, blue	1273
shale	422	lime	1276
lime	445	shale, drk.	1285
shale	455	lime	1286
lime	489	shale, blk.	1292
shale	497	gas & H F W	
lime	507	lime	1294
shale	545	shale, light	1296
lime	568	lime	1304
shale	581	sand	1309 wtr.
lime	591	lime	1430 Total Depth
shale	625		
shale, sdv.	645		
shale	667		
lime	671		
shale	689		
lime	694		
shale	698	gas	
lime	730		
shale	749		
lime	769		
shale, blk.	773	gas	
lime	780		
shale	785		
lime	788		
shale	815		
sand	822		
shale	945		