

Company- SHAMROCK RECONDITIONERS
Farm- Lynn No. 2SEC. 26 T. 28 R. 15E
NE/4
SW NE NE ?

Total Depth. 1260'

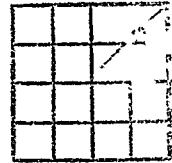
Cmpt. 4-10-57

Comp. 4-24-57

Est. or Treated.

Dr. D.D. Sandlin Drilling Co.

Est. 5-28-60

County Wilson
KANSAS

CASING:

No casing Run

Elevation. _____

Production. Dry

Figures Indicate Bottom of Formations.

lime	46
shale	165
lime	180
shale	305
lime	318
shale	328
lime	342
shale	369
lime	485
shale (black)	491
sand	498
lime	600
shale	652
dark lime	662
shale	681
lime	704
shale	790
lime	817
black shale	820
lime & shale	847
lime	871
shale	877
lime	883
shale	905
sand & shale	912
sandy shale	1044
shale dark	1065
sand & shale	1075
sandy shale	1154
shaly lime	1162
sand	1182 show of oil, lots wtr.
shale	1237
Miss. lime	1260
Total Depth	

Well was plugged with 5 sx. cement @
1160', 5 sx. @ 200' and 2 sx.
surface.