

WELL LOG BUREAU - KANSAS GEOLOGICAL SOCIETY.
412 Union National Bank Bldg, Wichita, Kansas.

Plotted J.S.


6-16-13W

SHELL OIL CO., Inc.
J.O. Bitter No. 5-B

SEC. 6 T. 16 R. 13W.
SE NW SE SE
S28° SL S33° EL SE $\frac{1}{4}$

Total Depth. 3356
Comm. 7-26-39 Comp. 9-4-39
Shot or Treated.
Contractor.
Issued. 10-14-39

County. Barton.

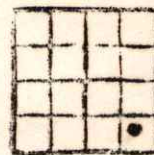

CASING.

35/8" 665'
4 1/2" 3348'

Elevation.

Production. Pot. 4991 B.
Depth. Allowed 2500B.
oil per day.

Figures Indicate Bottom of Formations.

surface soil	31
shale and sholls	112
shale & sholls and red rock	335
red rock and sholls	520
shale and red rock	620
shale and red bod	670
red rock shale and sholls	892
anhydrite	937
red rock shale & sholls	1026
shale and sholls	1269
shale and sholls & salt	1545
shale and salt	1610
broken limo	1756
limo	1813
broken limo	2005
limo	2052
broken limo	2113
limo	2173
shale and limo	2302
lime and shale	2608
limo	2648
shale and limo	2738
limo	3349
dolomite	3350
3350 equals 3349 S.L. Corr.	
dolomite	3349
Top Arbuckle Dolomite	3348 SLC
dolomite	3356

Total Depth.

2975-37 some porosity with very poor dead
oil staining. Water bearing.
3089-3217 fair porosity and spotted
oil staining.
3125-53 porous spotted light stain
throughout, not much stained
Probably oil with water.
3200-17 no oil staining. Water
bearing.
3349-3350 good porosity in bottom half foot. well
Oil stained.
3349-3350 well oil stained in streaks.
3350-3353 showing free oil.
200' Oil at 3350
250' oil at 2.25PM.
3030' oil at 3353.
3353-56 very little staining bur showing free
oil in clusters. 3030' oil 3356
3050' oil in hole.