

Company - C. MILLER
Farm - Corlett

No. 1.

SEC. 23 T. 9 R. 21 E
CS $\frac{1}{2}$ SW SE

23-9-21E

Total Depth. 1555'

Comm. 1-18-44


Comp. 1-31-44

Shot or Treated.

Contractor. Olie Berentz

Issued. 3-25-44

County. Leavenworth
KANSAS

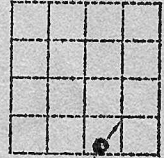

Plotted

CASING:

8 $\frac{1}{4}$ " 791'

65/8" 1370'

Elevation. 1042

Production. Dry

Figures Indicate Bottom of Formations.

shale blk	1276
sand	1290
shale dk	1310
shale wh	1314
shale sdy dk	1321
sand	1340
shale	1345
sand	1360
shale blk	1365
sand & shale	1394
lime <u>HF</u>	1555
Total Depth.	

Sand @ 1318

MISS

gas @ 836 *Pownee*
sand 1318
Miss. 1395-1555

1394
1042
352

1042
613
429

1042
613

soil	10
lime	12
sand & mud	38
shale	141
lime	144 ³
shale	262 ¹¹⁹
lime	264
shale	276
lime	302
shale	305
lime	307
shale	330
lime	340
shale	375
lime	386
sand	400
shale	430
lime	460
shale	470
lime	480
shale	492
lime	506
shale	520
lime	526
shale	530
lime	533
shale	539
lime	570
shale	573
lime	593
shale blk	596
lime	613
shale	725
lime	728
shale blue	750
shale	778
lime	783
shale	789
lime	798
shale	816
lime	820
shale	825
lime	836
shale	850
lime	866
shale	931
sand	941
shale sdy	1140
sand	1160
shale	1175
sand	1190
shale sdy	1255

BKC

BKC

BFS

CK