


Company. McLAUGHLIN ET AL
Farm. Miller No. 1.
(Bk of McLouth)

SEC. 17 T. 10 R. 20 E
NE SE NE

17-10-20E

Total Depth. 1724
Comm. 8-16-44 Comp. 10-12-44
Shot or Treated.
Contractor. W. D. Wilson
Issued. 2-24-45

County. Jefferson
KANSAS

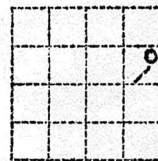

Elevation. 1160 Hawth

Production. Dry

CASING:

8" 977'
6 5/8" 1580'
5 3/16" 1688'

Figures Indicate Bottom of Formations.

surface	0-46	shale	980- 997
shale blue	90	lime	1000
lime	96	shale	1015
shale	99	lime	1018
lime	113	shale	1024
shale	147	lime	1033
lime	151	shale	1037
shale	160	lime	1045
lime	165	lime shells	1060
shale	180	shale lgt	1067
lime sdy	185	red bed	1070
shale	190	shale	1155
lime sdy	219	sand	1165
shale	229	shale	1210
lime	237	shale gy	1240
shale	242	shale sdy	1245
sand	255	shale gy	1285
shale	368	shale drk	1295
lime	372	shale lgt	1345
shale	383	shale drk	1350
sand, Water 6 bailers		shale gy	1370
on shale	421	shale drk	1420
shale	435	shale gy	1445
sand	455	shale drk	1482
shale	500	lime shells	1486
lime	505	shale blue	1512
shale	515	sand brkn	1520
lime	527	shale drk	1524
shale	530	shale lgt sdy	1527
lime	545	sand Show of Oil	1550
shale	555	shale drk sdy	1562
lime	572	shale sdy	1570
shale	576	shale drk	1582
shale red	578	lime	1587
shale	605	shale	1590
lime	620	lime	1635
shale	643	shale	1639
lime	655	lime	1666
shale	675	chat & shale	1675
lime shells	690	lime H.	1677
lime	701	lime S. Show of	lime
shale	717	Oil - little wtr	shale
lime	729	water sand	sand
shale	740	lime	shale
lime	745	shale	lime
shale	750	lime	8" csg 977 (hole
lime shells	756	sand	short 5' when csg
shale	762	lime H.	was run Lime should
lime	796	water sand Hole	have been 977)
shale	800	filled up 1500'	
lime	831	water	1724
shale	836	Total Depth	
lime shells	841		

850 All pipe pulled &
890 hole plugged
898
982
980