

Company • DAVE WILSON
Farm • Murphy

No. 1.

SEC. 9
C SW NE

T. 10

R. 21 E

Total Depth. 1283'

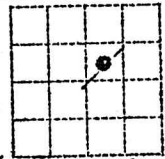
Comm. 5-11-44

Comp. 6-1-44

Shot or Treated.

Contractor. Dave Wilson

Issued. 8-12-44

County. Leavenworth
KANSAS

CASING:

8" 605'

65/8" 1148' UR 1017'?

Elevation. 902 McLaughlin

Production. Dry

Figures Indicate Bottom of Formations.

surface	20	lime	712
yellow clay	38	shale	716
shale sdy	50	lime	720
shale blue	70	wh shale	730
shale	135	lt shale	780
shale blue	140	shale gy	850
lime	170	shale sdy	870
shale	175	wtr sand	942
shale sdy	190	wh shale	955
lime	203	lt shale	975
shale	205	wtr sand	1010
lime	207	sand	1015
wh shale	211	sand wtr	1065
red shale	218	shale	1085
shale	234	shale dk	1100
lime	240	sand	1110
shale	243	shale dk	1130
lime	253	shale	1140
shale	292	shale blk	1147
lime	297	wh shale	1148
shale	299	shale blk	1150
lime	320	shale dk sdy	1155
shale	325	sand gy	1172
lime	327	wh sand	1180
shale	335	shale blk	1193
lime	342	wh shale	1199
shale gy	355	shale blk	1228
lime	367	gas sand	1231
shale	380	shale	1233
lime	383	sand gas	1237
shale	387	sand brkn	1247
lime	390	brkn oil sand	1255
shale & shells	402	shale	1275
lime	453	lime	1283
shale blk	455	Total Depth.	
lime	457		
shale	460		
lime	472		
shale	476		
sdw wh shale	485		
shale	540		
mud shale	574		
sand	584		
shale	586		
red shale	588		
shale	590		
lime	591		
shale	607		
hd lime	627		
shale	630		
lime	640		
shale sdy	650		
lime hd	672		
shale dk	675		
lime	683		
shale	695		
lime	703		
shale	705		
lime	709		

1275
ad2.
373