


23-107 23E

RUF DRLG. CO.
Mrs. Belshe No. 3.

SEC.23 T. 10 R. 23E
SEc SE

Total Depth. 850'
Comm. 3-18-32 Comp. 3-25-32
Shot or Treated.
Contractor. Ruf Drlg.Co.
Issued. 5-21-38

County. Wyandotte

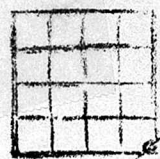

Elevation.

Production. Dry

CASING:

65/8" 471'
47/8" 765'

Figures Indicate Bottom of Formations.

clay	2	shale	403	red bed	725
sand rock	7	sand little gas	412	shale	748
clay	13	shale	426	sand	760
sand boulders	40	sand	430	shale & mud	774
lime	47	shale	438	lime	776
shale	68	sand- lime shells	446	shale white	SLM 805
lime	87	shale	452	lime	807
shale	107	sand	456	sdv shale white	818
lime	114	red bed	458	shale grey ex.drk	823
shale	115	sdv lime	470	sand	824
lime	118	shale green	481	about 250,000 Gas	
shale	120	SLM 473'8"		sand hrd	840
lime	126	lime	482	sand, some shale white	845
shale	158	shale	502	sand	850
lime Iola	185	lime	506	wtr in bottom	
shale	191	shale	510	Total Depth.	
lime	194	lime	514		
shale	196	shale	521		
lime	197	lime cap rock	527		
shale	207	sdv shale	537		
lime	218	sand gas	541		
shale	223	sand oil showing	552		
lime	236	lime Lex	557		
shale	251	shale blk wtr	561		
lime	254	sand white	567		
shale	256	lime	572		
lime	260	shale green	581		
shale	265	lime	582		
lime	294	shale-lime shells	590		
shale blk-little wtr	298	lime	591		
lime	320	shale	595		
shale	321	lime	599		
lime	324	shale	607		
shale blk-little wtr	326	sand hrd	625		
lime hrd Hertha	336	sand gas bubbles	630		
shale	337	sand oil show	640		
lime	339	shale	680		
shale-sh red bed	350	lime	681		
sand sh oil	358	shale	683		
sdv lime	367	lime	685		
shale	380	shale	702		
sand gas	398	brkn lime shells	723		

BV