

SUPERIOR OIL CORP.  
 David Jones (West) No. 12.


SEC. 21 T. 23 R. 13E.  
 NE SE SW  
 1195' N of SL  
 200' W of EL SW  $\frac{1}{4}$

Total Depth. 1707  
 Comm. 6-15-37 Comp. 7-12-37  
 Shot or Treated. 2000 gal.  
 Contractor. Company tools.  
 Issued. 8-21-37

County Greenwood.

CASING.

12  $\frac{1}{2}$ " 410'  
 10" 878'  
 8  $\frac{1}{4}$ " 1438' 8"  
 65/8" 1662'  
 2" 1712'

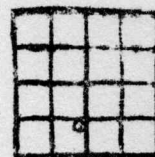

Elevation.

Production. 30 B.

Figures Indicate Bottom of Formations.

soil	12	shale	1148
shale	25	lime	1167
lime	40	shale	1170
shale	45	lime	1194
lime	55	shale	1246
shale	60	sdv shale	1250
red bed	85	8 BWPHR	
shale blue	95	lime	1254
lime	103	sdv shale	1268
shale	107	shale blk	1275
lime	111	lime	1280
shale	195	sand gas	1282
lime	205	lime	1300
shale white	217	shale	1317
lime	228	lime	1320
shale	227	shale	1365
lime	240	sand	1368
shale	255	shale	1536
lime	267	lime	1540
shale	290	shale	1658
shale	322	lime	1707
sdv shale	337	Pay 1675-32'	
water sand	351	Total Depth SLM	
6 BW		REMARKS--	
shale	442	Well put to pumping 18 hours after	
lime	449	finished treating and in 12 hours had rec-	
shale	574	overed oil used in treating, and the next	
lime	673	24 hours pumped 30 bbls of oil and 8 bbls wtr.	
shale	678		
lime	848		
shale	855		
red rock	860		
shale	871		
lime	873		
shale	877		
lime	881		
shale	895		
lime	953		
sand gas show	957		
lime	1018		
shale	1065		
sand	1070		
shale	1081		
sdv lime	1088		