

**TRILOBITE
TESTING INC.**

P.O. Box 1733 • Hays, Kansas 67601

Test Ticket

NO.

43941 16180

Well Name & No. 1-11 Bible-Hoss Unit Test No. 2 Date 08/09/11
Company Roberts Resources Inc Elevation 1900 ~~1525~~ KB 1901 GL
Address 2020 N. Tyler Rd Ste 106 Wichita, KS 67212
Co. Rep / Geo. Kent Roberts Rig Landmark 6
Location: Sec. 11 Twp. 30S Rge. 15W Co. Barber State KS

Interval Tested 3403 - 3425 Zone Tested Topeka
Anchor Length 22 Drill Pipe Run 3314 Mud Wt. 9.1
Top Packer Depth 3398 Drill Collars Run 88 Vis 44
Bottom Packer Depth 3403 Wt. Pipe Run 0 WL 10.0
Total Depth 3425 Chlorides 5000 ppm System LCM

Blow Description IF: Fair Blow, BOB in 11 minutes

TSI: Bled off, NO Blowback

FF: Strong Blow, BOB in 10 seconds

FST: Bled off, NO Blowback

Rec	Feet of	%gas	%oil	%water	%mud
<u>2240</u>	<u>Feet of GIP</u>				
<u>80</u>	<u>Feet of SOWGCM</u>	<u>40</u>	<u>3</u>	<u>2</u>	<u>55</u>
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec Total	<u>80</u>	BHT <u>104°</u>	Gravity <u>N/C</u>	API RW <u>N/C</u>	@ <u>N/C</u> °F Chlorides <u>N/C</u> ppm

(A) Initial Hydrostatic	<u>1711</u>	☒ Test	<u>1125'</u>	T-On Location	<u>12:15</u>
(B) First Initial Flow	<u>15</u>	☐ Jars		T-Started	<u>12:47</u>
(C) First Final Flow	<u>37</u>	☐ Safety Joint		T-Open	<u>14:41</u>
(D) Initial Shut-In	<u>1078</u>	☐ Circ Sub		T-Pulled	<u>17:43</u>
(E) Second Initial Flow	<u>21</u>	☐ Hourly Standby		T-Out	<u>19:35</u>
(F) Second Final Flow	<u>63</u>	☒ Mileage	<u>(60) 84'</u>	Comments	
(G) Final Shut-In	<u>959</u>	☐ Sampler			
(H) Final Hydrostatic	<u>1665</u>	☐ Straddle		☐ Ruined Shale Packer	
Initial Open	<u>30</u>	☐ Shale Packer		☐ Ruined Packer	
Initial Shut-In	<u>60</u>	☐ Extra Packer		☐ Extra Copies	
Final Flow	<u>30</u>	☐ Extra Recorder		Sub Total	<u>8</u>
Final Shut-In	<u>60</u>	☐ Day Standby		Total	<u>1359'</u>
		☒ Accessibility	<u>150</u>	MP/DST Disc't	
		Sub Total	<u>1209 / 1359</u>		


Approved By

Kent Roberts

Our Representative

[Signature]

Trilobite Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

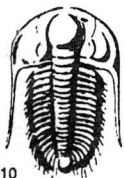

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

Test Ticket

NO. 43942

AUG 15 2011

Well Name & No. 1-11 Bible - Hoss unit Test No. 3 Date 08/10/11
 Company Roberts Resources Inc Elevation 1910 KB 1901 GL
 Address 2020 N. Tyler Rd Ste 106 Wichita, KS 67212
 Co. Rep / Geo. Kent Roberts Rig Landmark 6
 Location: Sec. 11 Twp. 30S Rge. 15W Co. Barber State KS

Interval Tested 3792 - 3832 Zone Tested Toronto
 Anchor Length 40 Drill Pipe Run 3694 Mud Wt. 9.4
 Top Packer Depth 3787 Drill Collars Run 88 Vis 54
 Bottom Packer Depth 3792 Wt. Pipe Run 0 WL 9.6
 Total Depth 3832 Chlorides 6000 ppm System LCM

Blow Description IF: Weak Blow, 6 inches
ISF: Bled off, NO Blowback
FF: Strong Blow, BOB in 20 seconds
FSI: Bled off, NO Blowback

Rec	Feet of	%gas	%oil	%water	%mud
<u>600</u>	<u>GIP</u>				
<u>70</u>	<u>Mud</u>				

Rec Total 70 BHT 108° Gravity NIC API RW NIC @ NIC °F Chlorides NIC ppm


(A) Initial Hydrostatic	<u>1928</u>	☒ Test	<u>1125"</u>	T-On Location	<u>21:15</u>
(B) First Initial Flow	<u>23</u>	☒ Jars	<u>250"</u>	T-Started	<u>21:36</u>
(C) First Final Flow	<u>43</u>	☒ Safety Joint	<u>75"</u>	T-Open	<u>23:59</u>
(D) Initial Shut-In	<u>847</u>	☐ Circ Sub		T-Pulled	<u>02:29</u>
(E) Second Initial Flow	<u>29</u>	☐ Hourly Standby		T-Out	<u>05:12</u>
(F) Second Final Flow	<u>52</u>	☒ Mileage	<u>(60) 84"</u>	Comments	
(G) Final Shut-In	<u>1344</u>	☐ Sampler			
(H) Final Hydrostatic	<u>1905</u>	☐ Straddle		☐ Ruined Shale Packer	

Initial Open	<u>30</u>	☐ Shale Packer	☐ Ruined Packer
Initial Shut-In	<u>30</u>	☐ Extra Packer	☐ Extra Copies
Final Flow	<u>30</u>	☐ Extra Recorder	Sub Total
Final Shut-In	<u>60</u>	☐ Day Standby	Total
		☒ Accessibility	MP/DST Disc't
		Sub Total	<u>1534 1684</u>

Approved By _____

Our Representative _____

Trilobite Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

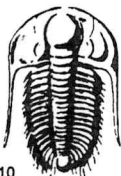

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

Test Ticket

NO. 43943

AUG 15 2011

Well Name & No. 1-11 Bible Hoss unit Test No. 4 Date 08/11/12
Company Roberts Resources Inc Elevation 1910 KB 1901 GL
Address 2020 N. Tyler Rd Ste 106 Wichita, KS 67212
Co. Rep / Geo. Kent Roberts Rig Landmark 6
Location: Sec. 11 Twp. 30S Rge. 15W Co. Barber State KS

Interval Tested 3824 - 3858 Zone Tested Upper Douglas Sand
Anchor Length 34 Drill Pipe Run 3726 Mud Wt. 9.4
Top Packer Depth 3819 Drill Collars Run 88 Vis 51
Bottom Packer Depth 3824 Wt. Pipe Run 0 WL 9.6
Total Depth 3858 Chlorides 5500 ppm System LCM

Blow Description IF: Fair Blow, BOB in 28 minutes

ISI: Bled off, No Blowback

FF: Fair Blow, BOB in 18 minutes

FSI: Bled off, Weak Surface Blowback

Rec	Feet of	%gas	%oil	%water	%mud
<u>20</u>	<u>GCM</u>	<u>2</u>			<u>98</u>
<u>60</u>	<u>MCW</u>		<u>56</u>		<u>44</u>
<u>180</u>	<u>water</u>				

Rec Total 260 BHT 109° Gravity N/C API RW .07 @ 85 °F Chlorides 95000 ppm

(A) Initial Hydrostatic 1913 ☒ Test 1125

(B) First Initial Flow 23 ☒ Jars 250

(C) First Final Flow 93 ☒ Safety Joint 75

(D) Initial Shut-In 1430 ☐ Circ Sub

(E) Second Initial Flow 87 ☐ Hourly Standby

(F) Second Final Flow 142 ☒ Mileage (60) 84

(G) Final Shut-In 1410 ☐ Sampler

(H) Final Hydrostatic 1857 ☐ Straddle

Initial Open 30 ☐ Shale Packer

Initial Shut-In 60 ☐ Extra Packer

Final Flow 30 ☐ Extra Recorder

Final Shut-In 60 ☐ Day Standby

☒ Accessibility 150

Sub Total 1534 1684

T-On Location 11:30

T-Started 12:09

T-Open 14:40

T-Pulled 17:42

T-Out 19:59

Comments

☐ Ruined Shale Packer

☐ Ruined Packer

☐ Extra Copies

Sub Total 8


Total 1684

MP/DST Disc't

Approved By Kent Roberts

Our Representative

Triobite Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

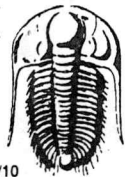

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

RECEIVED
AUG 17 2011

Test Ticket

NO. 43944

Well Name & No. 1-11 Bible-Hoss unit Test No. 5 Date 08/13/11
Company Roberts Resources inc Elevation 1910 KB 1901 GL
Address 2020 N. Tyler Rd Ste 106 Wichita, KS 67212
Co. Rep / Geo. Kent Roberts Rig Landmark 6
Location: Sec. 11 Twp. 30S Rge. 15W Co. Barber State KS

Interval Tested 4454 - 4516 Zone Tested Cherokee Sand
Anchor Length 62 Drill Pipe Run 4350 Mud Wt. 9.7
Top Packer Depth 4449 Drill Collars Run 88 Vis 49
Bottom Packer Depth 4454 Wt. Pipe Run 0 WL 9.2
Total Depth 4516 Chlorides 5000 ppm System LCM 1#

Blow Description IF: weak Blow, 1/4 inch
ISI: NO BLOW
FF: weak 1/8 inch Blow, Died off @ 2 minutes
FSI: NO BLOW

Rec	Feet of	%gas	%oil	%water	%mud
<u>5</u>	<u>Mud</u>				


Rec Total 5 BHT 116 Gravity N/C API RW N/C @ N/C °F Chlorides N/C ppm

(A) Initial Hydrostatic <u>2254</u>	☒ Test <u>1225</u>	T-On Location <u>14:30</u>
(B) First Initial Flow <u>21</u>	☒ Jars <u>250</u>	T-Started <u>14:49</u>
(C) First Final Flow <u>31</u>	☒ Safety Joint <u>75</u>	T-Open <u>17:36</u>
(D) Initial Shut-In <u>1199</u>	☐ Circ Sub	T-Pulled <u>18:37</u>
(E) Second Initial Flow <u>34</u>	☐ Hourly Standby	T-Out <u>20:45</u>
(F) Second Final Flow <u>43</u>	☒ Mileage <u>60</u> <u>84.00</u>	Comments
(G) Final Shut-In <u>986</u>	☐ Sampler	
(H) Final Hydrostatic <u>2224</u>	☐ Straddle	

Initial Open <u>15</u>	☐ Shale Packer	☐ Ruined Shale Packer
Initial Shut-In <u>15</u>	☐ Extra Packer	☐ Ruined Packer
Final Flow <u>15</u>	☐ Extra Recorder	☐ Extra Copies
Final Shut-In <u>15</u>	☐ Day Standby	Sub Total <u>0</u>
	☒ Accessibility <u>150</u>	Total <u>1784</u>
	Sub Total <u>1784</u>	MP/DST Disc't

Approved By Kent Roberts Our Representative [Signature]

Trilobite Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

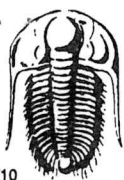

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

RECEIVED
AUG 17 2011

Test Ticket

NO. 43945

Well Name & No. 1-11 Bible-Hoss Unit Test No. 6 Date 08/14/11
 Company Roberts Resources inc Elevation 1910 KB 1901 GL
 Address 2020 N. Tyler Rd Ste 106 Wichita, KS 67212
 Co. Rep / Geo. Kent Roberts Rig Landmark 6
 Location: Sec. 11 Twp. 30S Rge. 15W Co. Barber State KS

Interval Tested 4556 - 4598 Zone Tested Viola
 Anchor Length 42 Drill Pipe Run 4445 Mud Wt. 9.4
 Top Packer Depth 4551 Drill Collars Run 88 Vis 50
 Bottom Packer Depth 4556 Wt. Pipe Run 0 WL 8.8
 Total Depth 4598 Chlorides 3000 ppm System LCM 1 1/2 #

Blow Description IF: NO Blow

ISI: NO Blow

FF: NO Blow, Flushed Tool, surface blow, Dead @ 8 minutes

FSI: NO Blow

Rec	Feet of	%gas	%oil	%water	%mud
<u>5</u>	<u>Mud</u>				

Rec Total 5 BHT 116° Gravity N/C API RW N/C @ N/C° F Chlorides N/C ppm

(A) Initial Hydrostatic 2268 ☒ Test 1225'
 (B) First Initial Flow 29 ☒ Jars 250'
 (C) First Final Flow 31 ☒ Safety Joint 75'
 (D) Initial Shut-In 152 ☐ Circ Sub
 (E) Second Initial Flow 32 ☐ Hourly Standby
 (F) Second Final Flow 55 ☒ Mileage 60 84'
 (G) Final Shut-In 153 ☐ Sampler
 (H) Final Hydrostatic 2243 ☐ Straddle

T-On Location 11:30
 T-Started 11:55
 T-Open 14:03
 T-Pulled 15:42
 T-Out 18:01

Comments


Initial Open 15 ☐ Extra Packer
 Initial Shut-In 30 ☐ Extra Recorder
 Final Flow 15 ☐ Day Standby
 Final Shut-In 30 ☒ Accessibility 150'
 Sub Total 1784'

☐ Ruined Shale Packer
☐ Ruined Packer
☐ Extra Copies
 Sub Total 0
 Total 1784'
 MP/DST Disc't

Approved By Kent Roberts

Our Representative [Signature]

Trilobite Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

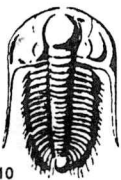

**TRILOBITE
TESTING INC.**

P.O. Box 1733 • Hays, Kansas 67601

RECEIVED
AUG 17 2011

Test Ticket

NO. 43946

Well Name & No. I-11 Bible-Hoss unit Test No. 7 Date 08/15/11
Company Roberts Resources inc Elevation 1910 KB 1901 GL
Address 2020 N. Tyler Rd Ste 106 Wichita, KS 67212
Co. Rep / Geo. Kent Roberts Rig Landmark 6
Location: Sec. 11 Twp. 30S Rge. 15W Co. Barber State KS

Interval Tested 4472 - 4352 Zone Tested Upper Viola
Anchor Length 80 Drill Pipe Run 4384 Mud Wt. 9.4
Top Packer Depth 4467 Drill Collars Run 88 Vis 50
Bottom Packer Depth 4552 Wt. Pipe Run 0 WL 8.8
Total Depth 4697 Chlorides 3000 ppm System LCM 1 1/2 #

Blow Description IF: weak Blow, 1/2 inch
ISI: NO Blow
EF: weak surface Blow
FSI: NO Blow

Rec	Feet of	%gas	%oil	%water	%mud
<u>60</u>	<u>Mud</u>				

Rec Total 60 BHT 117 Gravity NIC API RW NIC @ NIC °F Chlorides NIC ppm

(A) Initial Hydrostatic 2220 ☒ Test 1225'
(B) First Initial Flow 31 ☒ Jars 250'
(C) First Final Flow 41 ☒ Safety Joint 75'
(D) Initial Shut-In 1307 ☐ Circ Sub
(E) Second Initial Flow 50 ☐ Hourly Standby
(F) Second Final Flow 58 ☒ Mileage 60A 84'
(G) Final Shut-In 316 ☐ Sampler
(H) Final Hydrostatic 2188 ☒ Straddle 600'

T-On Location 14:30
T-Started 15:30
T-Open 17:41
T-Pulled 19:13
T-Out 21:42
Comments

Initial Open 15
Initial Shut-In 45
Final Flow 15
Final Shut-In 15

☐ Shale Packer
☐ Extra Packer
☐ Extra Recorder
☐ Day Standby
☒ Accessibility 150'
Sub Total 2234

☐ Ruined Shale Packer
☐ Ruined Packer
☐ Extra Copies
Sub Total 0
Total 2384
MP/DST Disc't

Approved By Kent Roberts

Our Representative

TriLOBITE TESTING Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.