

11-11-23E Plotted *Hand*

Company Messler et al
Wyandotte
Farm County Farm


No. 1

Sec. 11 T. 11N3 R. 23E
Loc.

Total Depth 812'
Comm. Apr. 1930
Shot or Treated
Contractor
Issued

Comp. May 16, 1930

County Wyandotte

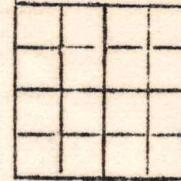

Casing

20 in.	10 in.
15 1-2	8 1-4
12 1-2	6 5-8
13 3-8	5 3-16

Elevation

Production 10 bbls. (Maybe)

Knobtown

Figures Indicate Bottom of Formation

Shale	28'	Shale	495
Lime	32	Sand showing of gas	516
Shale	40	Lime	520
Lime	62	Shale	539
Shale	70	Lime	545
Lime	78	Shale	547
Shale	81	Sand	552
Lime	105	Shale	568
Shale	122	Sand	572 show oil & gas
Lime	128	Shale	576 H ₂ O
Shale	131	Lime	582
Lime	135	Shale	698
Shale	154	Lime	702
Lime	180	Shale	718
Shale	203	Red Rock	721
Lime	210	Shale	740
Sand	217	Lime	742
Shale	222	Shale	812 Lots water
Red Rock	227		
Shale	240		
Lime	245	Top Miss. Lime ?	
Shale	267		
Lime	272		
Shale	280		
Lime	295		
Shale	297		
Lime	305		
Shale	315		
Lime	333		
Shale	339		
Lime	341		
Shale	345		
Lime	353		
Shale	358		
Sandy shale	381		
Sand	405 show oil 10bbls. from Knobtown		
Shale	468		
Coal	472		