

23-12-23E

Company

NE $\frac{1}{4}$ SE $\frac{1}{4}$ SW $\frac{1}{4}$

Sec. 23

T. 12

R. 23

Loc.

Farm Mrs. Lynn

No. 1

Total Depth 600'

Comm. 6-4-24


Shot or Treated

Contractor

Issued

Comp.

County Johnson

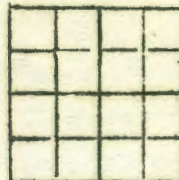

Casing

20 in.

10 in.

15 1-2

8 1-4

12 1-2

6 5-8

13 3-8

5 3-16

Elevation

Production

Figures Indicate Bottom of Formation

Surface	5'	Top of sand	430
Lime	25	Dark shale	438
Dark shale	27	Lime	442
Lime	34	Sand	460
Blue shale	76	Red rock	465
Lime	80	White shale	472 (Casing)
Blue shale	82	White shale	476
Lime	86	Black shale	485
Blue shale	99	White shale	495
Lime	109	Blue shale	499
Black slate	114	Sand gas	509
Lime	116	White shale	543
Dark shale	119	Blue shale	550
Lime	127	Dark sandy shale	566
Blue shale	144	Top of sand	566
Lime Fatie	177	Sand	600
Black shale (gas)	183	Bottom of hole	600'
Lime	203		
Black sand & gas	207		
Lime	209		
Dark shale	211		
Lime	219		
White shale	224		
Sand & gas	237		
Blue shale	247		
Sand gas	287		
Blue shale	325		
White shale	345		
Black shale	350		
Red rock	355		
White shale	370		
Blue shale	388		
Lime	394		
Blue shale	398		
Lime	402		
Dark shale	408		
Lime from 419	424		
White shale	426		