

8-14-23 E

Company Dangelmaier et al

Sec. 8 T. 14 R. 23

Farm Wm. H. Pundt

No. 2

Loc. NE cor SW $\frac{1}{4}$ of NE $\frac{1}{4}$

Total Depth 656'

Comm. 10-31-34


Comp. 11-9-34

County Johnson

Shot or Treated

Contractor Earl Smith

Issued

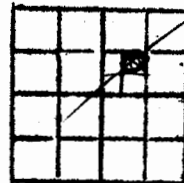

Casing

20 in.	10 in.	
15 1-2	8 1-4	
12 1-2	6 5-8	598'
13 3-8	5 3-16	

Elevation 1256

Production (50,000 gal) Dry & Plugged

Figures Indicate Bottom of Formation

Surface	8'	Shale - black	329
Shell lime	15	Lime	332
Shale - dark	23	Shale	336
Lime	32	Lime <i>Hertha</i>	343
Shale - light	40	Shale - white	522
Lime	49	Lime	528
Shale - black water	50	Shale - dark	530
Lime	53	Lime	532
Shale - light	75	Shale - dark	538
Lime -	89	Lime	547
Shale - dark	92	Shale	565
Lime	125	Lime	568
Shale - light	142	Shale - black gas	573
Lime	165	Lime <i>to Scott</i>	575
Shale - blue	181	Shale - light	580
Lime	188	Lime	582
Shale - blue	205	Shale	592
Lime	215	Red rock	596
Shale	219	Shale	598
Lime	226	Shale - dark	608
Shale	258	Lime	610
Lime	260	Shale	628
Shale - dark	268	Sand - gas 50,000 <i>Squirt</i>	643
Lime	296	Shale - sandy	656
Shale - black	302		
Lime	325		

Dry hole

Casing pulled and hole plugged.