


WELL LOG BUREAU—KANSAS GEOLOGICAL SOCIETY
503 East Murdock, Wichita, Kansas

Company- ELDORADO REFINING COMPANY
Farm- Keining No. 1

SEC. 5 T. 16 R. 4E
NW NW SE

Total Depth. 2315
Comm. 6-10-53 Comp. 6-28-53
Shot or Treated.
Contractor. Slusser Drlg. Co.
Issued. 7-18-53

County Dickinson
KANSAS

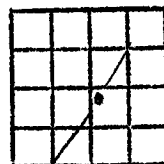

CASING:

8 5/8" 144'
5 1/2" 2278' P. 2092.95'

Elevation. 1351

Production. Dry

Figures Indicate Bottom of Formations.

surface soil	5
lime broken	75
gyp broken	124
lime & shale	144
lime	165
lime & shale	220
lime	320
lime & shale	400
shale	430
lime	450
shale & shells	930
lime	965
shale & shells	1215
lime & shale	1300
lime	1330
lime & shale	1535
shale	1575
shale & shells	1670
lime	2065
shale & lime	2110
lime & shale	2276
shale	2277
chat	2285 RTD
chat firm	2302
chat sft	2312
lime	2315
Total Depth	

Tops:
Conglomerate 2268
Miss. 2273

2279 poor-fair sho. rather heavy.
oil/Trip. ch. 2 DST's failed: 3rd
test tool plugged to run 5 1/2" @
2275' CO to 2282 RTD no fluid, let
set o' nite. To DD. 100' wtr &
scum oil o' nite bailed 1/2 hr.
WPH DD 2293 1 BWPH. DD 2309 5
blr. WPH 4 BWPH & scum oil.