

Company Texas

Farm D. Mundell

Total Depth 412

Comm.

Shot or Treated

Contractor


Issued

No. W-7

Comp. 4/17/37

13-21-22E
Sec. 13 T. 21 R. 22
Loc. 730' from No. and 10' from
West Lines, SW $\frac{1}{4}$

County Linn

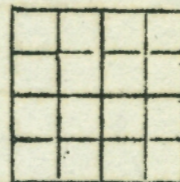

Casing

20 in.	10 in.	
15 1-2	8 1-4	19
12 1-2	6 5-8	369
13 3-8	5 3-16	

Elevation

Production

Figures Indicate Bottom of Formation

Soil & Boulder	Drk	Sft	5	Shale	Gray	Med	240
Clay & Sandstone	Y	Med	20	Lime	"	"	250
Shale	Gray,	Med	25	Shale	"	"	258
"	"	"	35	Lime	Br	Hd	275
Sand & Gravel	Yel	Sft.	38	Shale		Med	285
Sandy Shale	Gray	Med	55	Lime	Gray	Sft	292
Shale	"	"	70	Shale-Sdy	Drk.	Med	305
Sandy	"	"	100	Shale	"	"	320
"	"	"	150	Lime	"	"	327
"	Lt	Sft	160	Sandy Shale	"	"	335
"	Gr	Med	172	Lime		"	347
Lime	"	"	182	Shale	"	"	356
"	"	Sft	186	Lime	Gray,	Sft	363
Shale	Lt	Med	194	Sandy-Shale	Drk.	Med	366
Lime	Br.	Hd	207	Shale	Drk.	Med	369
				"	Lt	Sft	387
				Gas-Sand	Drk.	Med	389
				Brkn-Sand	"	Sft	401
				Sand	"	"	403
				Brkn Sand,	"	"	405
				Sand	"	"	409
				Sandy-Shale, Bl,	"	"	412