


13-Plot 22E

Company Texas
 Farm D. Mundell No. 21-W

Sec. 13 T. 21 R. 22
 Loc. 1320' from W. & 870' from S.
 Lines of SW 1/4

Total Depth 352
 Comm. Comp. 8/16/37
 Shot or Treated
 Contractor
 Issued

County Linn

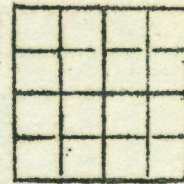

Casing
 20 in. 10 in.
 15 1-2 8 1-4 28
 12 1-2 6 5-8 308
 13 3-8 5 3-16

Elevation

Production

Figures Indicate Bottom of Formation

Soil & Clay	Drk	Med	10	Lime	Gray	Hard	266
Sand	"	Sft	17	Shale	"	Med	275
Gravel	"	"	26	Lime	"	Hd	282
Shale	Gray	Med	45	Shale	Drk	Med	284
Shale-Bl	Blue	Sft	80	Lime	"	"	286
Sdy Shale	Gr	Med	96	Blk. Slate	Blk	"	288
Shale	Blk	"	100	Shale	Drk	"	291
"	Gr	"	109	Lime	Gray	Hd	294
Lime	"	Hd	114	Shale	"	Med	296
Shale	Lt	Med	117	Lime	"	"	297
"	"	"	132	Shale	Lt	"	304
Lime	Br	Hd	145	Sdy Shale	"	"	315
Sdy Shale	Gr	Med	165	Sand	Gr	"	318
Shale	"	"	182	"	"	"	322
Sdy Shale	Drk	"	196	"	Br	Sft	324
Lime	Br	"	208	"	Dr. Gray	Med	330
Sdy Shale	Drk	"	212	"	Br	"	333
Lime	Gray	"	214	"	"	"	336
Shale	Drk	"	223	"	"	"	342
Lime	Grey	Hd	229	"	"	"	345
Shale	Drk	Med	235	"	Drk.	"	348
"	"	"	256	"	Blue	Sft	351
				Brkn Sand & Shale	"	"	352 Blue