

14-21-22
Plotted
miller 0

Company Texas

Sec. 14 T. 21 R. 22
Loc. 890' from E. and
490' " N Lines Of SE 1/4

Farm D. Mundell


No. 22

County Linn

Total Depth 475

Comp. 1/13/38

Comm.
Shot or Treated
Contractor
Issued

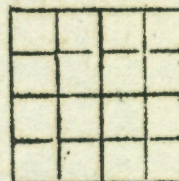

Casing
20 in. 10 in.
15 1-2 8 1-4 12
12 1-2 6 5-8 445
13 3-8 5 3-16

Elevation

Production

Figures Indicate Bottom of Formation

Soil & Boulders	Drk. Med	4	4	Shale	Sandy, Gray, Hd	256	Hd
Lime	Grey, Hd	10	10	Lime	Br. Hd	263	3
Lime	Drk.	"	26	Shale	Drk. Med	266	
Shale	"	Sft	30	"	Sandy Lt	"	280
Lime	Grey	Hd	45	"	Gray	"	282
Lime	"	"	47	"	Sandy	"	310
Shale	"	Med	52	Slate	"	"	311
Lime	"	Hd	54	Shale	"	"	315
Shale	Drk. Med	58	58	Lime	"	"	328
Lime	Gray	"	59	Shale	"	"	332
Shale	"	"	61	Lime	"	"	333
Lime	"	"	67	Shale	Gray, Med	342	
Shale	"	"	70	Lime	"	Hd	349
Lime	Br.	Hd	77	Slate	Blk	Sft	350
Shale-Sandy	Lt	Med	90	Shale	Drk.	Med	360
"	Gray	"	95	"	Sandy	"	376
Sand	"	Hd	100	Lime	Gray	"	378
Shale-Sandy	"	"	120	Shale	Sandy	"	388
"	"	Med	130	Lime	Gray	"	390
"	"	"	150	Shale-Sandy	Lt.	"	394
"	"	"	190	Lime	Br.	Hd	400
"	Slate	Drk.	192	Shale	"	Med	401
Lime	Br	"	197	Lime	"	"	404
Shale-Sandy	Gray	"	215	Slate	Blk.	Sft	406
"	"	"	224	Shale-Sandy	Lt. Med	"	412
Slate	"	"	225	Lime	Gr.	"	415
Lime Shale	"	"	229	Shale	Lt	"	426
Lime	"	Hd	234	"	Sandy	Gr	"
				Lime-Sandy	"	"	435
				Sand	Wht	"	445
				"	"	"	457
				"	"	"	468
				Sand	"	"	472
				Shale-Sandy	Blue, Sft.	"	475