


Company- THE TEXAS COMPANY  
Farm- D.A. Lee O/A (Gr.#6) No. 10

SEC. 14 T. 21 R. 22E  
NW SW NE  
255' fr NL & 890' fr EL of  
the SW/4 NE/4  
County Linn  
KANSAS

Total Depth. 428 PB 421  
Comm. 6-3-42 Comp. 6-9-42  
Shot or Treated.  
Contractor. Lemons & Shewmaker  
Issued. 3-22-52

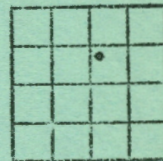

## CASING:

8 1/4" 12'  
6 5/8" 374'  
3" 376' Pulled  
2" tubing 418'

Elevation. \_\_\_\_\_

Production. 3 bbls. oil

Figures Indicate Bottom of Formations.

soil & clay	5	CO after shot. (Shot weighted with
clay & gravel	8	water - did not come out) Drilled
lime gray	18	pocket to 428'. 24 hrs.
shale gray	32	6-11-42 = 3 bbls. water & 1 bbls.
lime gray	35	oil in hole after standing 8 hrs.
shale gray	164	CO & wash sand
lime gray	176	6-12-42 = CO to 423'. Run tubing
gray shale	188	and rods.
lime gray	202	
gray shale sdy	218	
shale gray	254	
lime gray	268	
gray shale	271	
gray lime	274	
gray shale	281	
gray lime	286	
gray shale	289	
blue shale wtr 2 BWH	291	
gray shale sandy	294	
gray shale	318	
gray lime	322	
gray shale	324	
gray lime	343	
blk slate	347	
wtr 345'		
gray lime	349	
gray shale	352	
gray lime	357	
gray shale sandy	368	
gray sand	373	
oil show		
sand, drop 3" slip		
in hole (brn) 377, RTD		
sand & shale	382	
sand	386	
sand & shale blk & brn	389	
brown sand	399	
sand & shale blue	401	
sand brn & gray	422	
blk shale	423	
shale Cores 377-423	428	
Total depth,	PB 421	

## Remarks:

Shot with HFW. 1 bbl. oil &  
3 bbls. water in hole 8 hrs.  
after CO Shot.  
Rotary cored Squirrel sand  
377-423'.  
6-9-42 SR 377-412 8 hrs.  
6-10-42 SR to 421 shot with  
39 qts. SNG 383-421. Pulled  
& rerun 374' 6 5/8".