

Company-The TEXAS COMPANY

Farm- D. A. Lee

No. 8-W

(Gr.#6)

SEC. 14 T. 21 R. 22E

NE NE SE NW

30' frm EL, 10' frm NL, SE NW

Total Depth. 431½ SLM

Comm. 5-25-42

Comp. 6-3-42


Shot or Treated.

Contractor. Lemons & Shewmaker

Issued. 3-22-52

County Linn

KANSAS

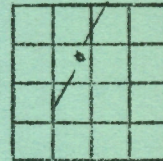

Elevation. _____

Production. Water Input

Figures Indicate Bottom of Formations.

CASING:

8½" 12'
 6½" 369' P.
 3" 399' P.
 2" 431½' tubing

soil, clay yellow med	12
lime, gry hrd	17
shale, " med	19
lime, " "	31
shale, " "	43
lime, " "	45
shale, " "	151
shale sandy lgt med	159
shale, gry med	180
lime, " "	189
shale, " "	202
lime, " "	214
shale, " "	270
lime, " hard	282
shale, blue med	284
lime, gry "	287
shale, blue "	294
lime, gry W	300
slate, blk "	304
shale, gry "	332 SLM
Water 1½ BPH @ 304	
lime, gry med	344
shale, " "	346
lime, " "	362
slate, blk "	368
Water @ 365	
shale, gry med.	373
lime, gry "	375
shale, " "	385
sand, " "	390
sand, shale gry med	395
sand, brown med.	399
Oil Show 390-431½	
shale, blue med	400
Rotary cored	
sand oil, brown med	403
shale sandy drk "	
Slight Show	412
sand oil, brown med	
Bleeds	417
shale sandy drk "	
Slight Show	420
sand (micaceous) black hd	
No Oil	424
shale sandy, drk med	426
sand (micaceous) blk hd	429
Total depth	431½ SLM

Production before shot: 40' oil in hole
 " after " : Not taken

Rotary cored 399-431½.
 Oil sand 399'9"-429

5-31 Pulled 3" pipe & SR hole 399-429. 1 Tour.
 6-1 Idle 8 hrs. ½ BW; 1/5 BO in hole 1 "
 Show w.23 qts. SNG, 403-429, 1200# sand
 tamp shot. CO after shot.
 6-2 CO & washign sand to 429. 1 tour.
 6-3- Idle 8 hrs. 40' oil & 5' wtr in hole;
 5' cave. CO & bailed dry.
 Run 2" tubing to 431½ w/rag packet at 400'
 Cemented over packer w/6 sx & 3 sx sand.
 Pulled 369' of 6½" casing. 1 tour.
 Cable tools from 0-399
 Rotary 399-431½ SLM