

14-21-22E 1660 E.M.


Company Texas
 Farm D. Mundell
 Total Depth 435
 Comm.
 Shot or Treated
 Contractor
 Issued

No. 10/12/37
 14-W

Comp. 10/12/137

Sec. 14 T. 21 R. 22
 Loc. 180' from E & 510' from
 North Lines of SE 1/4

County Linn

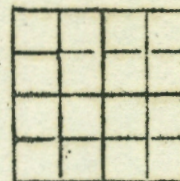

Casing
 20 in. 10 in.
 15 1-2 8 1-4 9
 12 1-2 6 5-8 389
 13 3-8 5 3-16

Elevation

Production

Figures Indicate Bottom of Formation

Soil & Clay	Drk.	Med	9	Lime	Gr	Hd	307
Lime	Gr	"	14	Slate	Blk	Med	308
Gravel	Drk	Sft	17	Lime	Gr	"	310
Lime	Gr	Med	24	Shale-Sdy	Drk	"	322
Shale	Drk	"	26	"	"	"	338
Lime	Gr	"	33	Lime	Gr	"	346
Shale	"	"	46	Shale-Sdy	Drk	"	354
Sand	"	"	49	Lime	Br	"	366
Shale-Sdy	"	"	80	Slate	Blk	"	373
"	"	"	125	Lime	Gr	Hd	378
"	"	"	155	Shale-Sdy	Drk.	Med	383
"	Lt	"	173	"	Lt	Sft	389
"	Drk	"	188	Sand	Gray	Med	404
Lime	Gray	"	198	"	"	"	406
Shale Sdy	Lt	"	212	"	Drk	"	416
" Lime-Shells	"	"	217	"	"	Sft	428
Lime	Br	Hd	220	" Brkn	"	Med	431
"	"	"	226	Shale	"	Sft	434
Shale-Sdy	Lt	Med	245				
"	Gray	"	262				
"	Sdy	"	275				
Lime	Br	Hd	288				
Shale	Drk	Med	293				
Lime	Gr	Hd	286				
Shale	Drk	Med	302				