

Company Jones & Crowder

Farm Burkhead

No. 3

34-21-23 E
Sec. 34 T. 21 R. 23 E

Loc. SE NE NW

County Linn

Total Depth

Comm.

Comp. Sept. 1945


Shot or Treated

Contractor

Issued

Casing

20 in.	10 in.
15 1/2	8 1/4
12 1/2	6 5/8
13 3/8	5 3/16

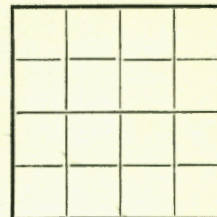

Elevation

Production

Figures Indicate Bottom of Formation

soil	2
gravel	10
lime	30
shale	35
lime	55
shale	60
lime	85
shale	212
red bed	218
shale	231
lime-	245
Alra shale	260
lime	275
Bnd shale	333
lime	348
Pwn shale	361
lime	367
sand broken 150M	369 gas
shale	400
lime	405
FS shale	410
lime	425
slate black	438
shale light	457
✓ sand gas	467
✓ sand oil	479
shale light	483 Bottom

Reduced hole 443 run 6 1/4 casing left in hole

Set 483 2" tubing packer

Made 150 M some oil.

Sept. 1945

Log of Burkhead # 3

NW 1/4 of NW 1/4 Sec. 34, Twp. 21, Rge. 25,
Linn County, Kansas

Drilled for Jones, Jones, & Crowder

Thickness	Formation	Depth
2	Soil	2
8	Gravel	10
20	Lime	30
5	Shale	35
20	Lime	55
5	Shale	60
25	Lime	85
127	Shale	212
6	Red bed	218
13	Shale	231
14	Lime	245
15	Shale	260
15	Lime	275
58	Shale	333
15	Lime	348
13	Shale	361
6	Lime	367
2	Shale broken	369 gas
31	Lime	400
5	Lime	405
5	Shale	410
15	Lime	425
13	Slate black	438
19	Shale light	457
10	Sand gas	467
12	Sand oil	479
4	Shale light	483 bottom

Reduced hole 443 Run 6 1/2 casing- left in hole
Set 483' 2" tubing and packer.