

Company Claude Crowder

Farm O.W. & J Glover

No.

Sec. 20 T. 21 R. 24E

Loc. N/2

County Linn

Total Depth


Comm.

Shot or Treated

Contractor

Issued

Comp.

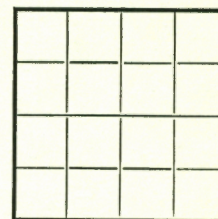

Elevation

Production

Casing

20 in.	10 in
15 1/2	8 1/4
12 1/2	6 5/8
13 3/8	5 3/16

Figures Indicate Bottom of Formation

1	Soil	1	
3	Gravel	4	Tubing & Packer
14	Lime	18	set to catch
4	Shale Gray	22	both flow of
5	Lime	27	gas
10	Shale Gray	37	
8	Lime	45	Tested 50,000
15	Shale Gray	60	
7	Lime	67	
108	Shale Gray	175	
10	Shale Red	185	
10	Shale Dark	195	
15	Lime	210	
5	Shale Blue	215	
5	Shale Light	220	
18	Lime	238	
25	Shale Light	293	
25	Lime	318	
7	Shale Blue	325	
4	Lime	329	
5	Shale Black	334	
11	Shale Sandy	345	
25	Shale Blue	370	
5	Shale Light	375	
18	Shale Lime	393	
7	Shale Black	400	Gas
5	Lime	405	
10	Shale Dark	415	
15	Shale Light	430	
71	Shale Dark	501	
2	Lime	503	
7	Shale Black	510	
20	Shale Light	530	
15	Shale Dark	545	
9	Shale Light	554	
3	Lime	557	
3	Shale Black	560	Gas
8	Shale Dark	568	
22	Shale Light	590	
7	Shale Dark	597	
7	Shale Light	604	
4	Shale Dark	608	
12	Shale Light	620	

Gift From
Claude Crowder

Company

Farm Glover

No.

Sec. 20 T. 21 R. 24E

Loc.

County

Total Depth

Comm.

Shot or Treated

Contractor

Issued

Comp.

Casing

20 in.

10 in

15 1/2

8 1/4

12 1/2

6 5/8

13 3/8

5 3/16

Elevation

Production

Figures Indicate Bottom of Formation

12 Shale Blue

632

53 Sand Dry

685

43 Shale Blue

728

15 Miss. Lime

743

Gift From
Claude Crowder