


WELL LOG BUREAU -- KANSAS GEOLOGICAL SOCIETY  
508 East Murdock, Wichita, Kansas

Company - CHAS. E. JOHNSON ETAL  
Farm - Elsbury No. 1

SEC. 10 T. 22 R. 13E  
SW SE NE NW  
400' W, 100' N of Sec NE NW

Total Depth. 1548  
Comm. 10-14-49 Comp. 11-13-49  
Shot or Treated.  
Contractor. Jerome Flory  
Issued. 1-21-50

County. Greenwood  
KANSAS

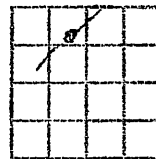

CASING:

8" 710'  
7" 1215'  
6" 1479' pipe tally showed 1485'

Elevation. \_\_\_\_\_

Production. dry

Figures Indicate Bottom of Formations.

soil	1	lime gry	1477
clay	20	lime sdy	1479
shale	90	SLM 1483	
lime	135	Corrected dept	1483
shale	140	lime sdy	1486
lime	155	shale sdy drk	1490
shale	170	shale sdy	1518
lime	180	lime	1520
shale	195	sand dry	1534
lime	205	shale sdy lgt	1544
shale	215	shale drk	1548
lime	223	Total depth	
shale	225		
lime	230	Pipe pulled 11-14-49	
shale	240	Plugged 11-15-49	
lime	250		
shale	265		
lime	270		
shale	290		
shale	350		
lime	395		
shale	400		
lime	425		
shale blk	435		
shale	453		
lime	461		
shale	653		
lime	662		
water sand	700		
shale	710		
shale	775		
lime	910		
shale	930		
lime	1025		
shale	1030		
red bed	1035		
shale	1075		
lime sdy, water	1085		
shale	1086		
lime sand line	1193		
SLM 1182 showed 1178'			
shale	1195		
lime	1205		
shale	1320		
lime sdy	1325		
shale	1375		
lime	1380		
shale	1410		
lime	1425		
shale	1450		
lime	1456		
shale	1469		
lime caps, brwn	1473		
slate blk	1476		