


Company Claude Crowder
 Farm Union Central Life Ins. Co. No. 1

Sec. 5 T. 25 R. 23E
 Loc. W/2 SW/4
 County Bourbon

Total Depth
 Comm. Nov 1938 Comp.
 Shot or Treated
 Contractor
 Issued

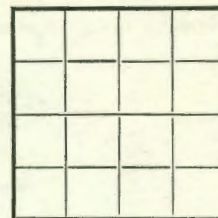

Casing
 20 in. 10 in
 15 1/2 8 1/4
 12 1/2 6 5/8
 13 3/8 5 3/16

Elevation

Production

Figures Indicate Bottom of Formation

20	Soil & Clay	20	
21	Shale	41	
10	Lime	51	
32	Shale	83	
31	Oil Sand	114	
11	Light Shale	135	
6	Dark Shale	141	
16	Lime	157	Gas
3	Shale	160	
7	Lime	167	
32	Dark Shale	199	Gas
12	White Shale	211	
20	Lime	231	Oswego
4	Black Slate	235	
5	Lime	240	
6	Light Shale	246	
9	Sand	255	
58	Blue Shale	313	
2	Lime	315	
5	Dark Shale	320	Set 496' 2"
3	Lime Shells	323	tubing, poor
7	Dark Shale	330	man's packer set
23	Light Shale	353	at 476' perforation
3	Lime	356	3' below packer
9	Black Slate	365	can be swabbed
35	Light Shale	400	to bottom
12	Dark Shale	412	
8	Black Slate	420	
3	Light Shale	423	
21	Broken Sand	444	Dry
13	Black Slate	457	
8	Sand	465	
5	Broken Sand	470	
3	Dark Shale & Sand	473	
5	Shale Dark	478	
7	Gas Sand	485	
11	Sand & White Shale	496	

Gift From
 Claude Crowder