

9-26-3E


JAN 25 1969  
COMPANY Oil Property Management, Inc.  
FARM Benfer  
NO. 5

SEC. 9 T. 26 R. 3E  
LOC. NE/4, SW/4, SW/4

TOTAL DEPTH 2864'  
COMM. 11-25-68 COMP. 12-2-68  
SHOT OR TREATED  
CONTRACTOR SeRoBee Drilling Co., Inc.  
ISSUED December 5, 1968

COUNTY Butler

KANSAS

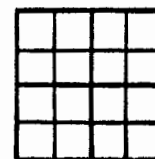

CASING  
20 10  
15 8-5/8", 200' W/175 sax  
12 6  
13 5-1/2" 2864'

ELEVATION 1352

PRODUCTION Oil

FIGURES INDICATE BOTTOM OF FORMATIONS

|      |      |                     |
|------|------|---------------------|
| 0    | 597  | Lime & Shale        |
| 597  | 1220 | Shale W/lime strks. |
| 1220 | 2783 | Shale & Lime        |
| 2783 | 2795 | Chert & Lime        |
| 2795 | 2820 | Miss. Lime          |
| 2820 | 2864 | Lime & Chert        |

### GEOLOGICAL TOPS

|                |      |
|----------------|------|
| K C            | 2323 |
| Cherokee Shale | 2714 |
| Conglomerate   | 2762 |
| Miss.          | 2783 |
| T. D.          | 2864 |

2780 2795 D S T  
Open 2 hours, received 70' clean oil,  
40' Slightly fresh muddy water.  
Initial Bottom Hole 512" in 30 minutes  
Final 465 in 30 minutes  
Low pressure 2347