


WELL LOG BUREAU--KANSAS GEOLOGICAL SOCIETY
 508 East Murdock, Wichita, Kansas

Company- **BUFFALO DEVELOPMENT CO.**
 Farm- **Brazil Ranch** No. **2**

SEC. **16** T. **27** R. **16E**
 NE SW SW

Total Depth. **1211'**
 Comm. **10-18-57** Comp. **12-1-57**
 Shot or Treated.
 Contractor. **Boyd Bogle**
 Issued. **7-8-61**

County **Wilson**
KANSAS

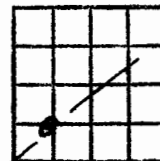

Elevation. **??**

Production. **Dry**

CASING:

10" 11'
 8" 470'
 6" 840'

Figures Indicate Bottom of Formations.

soil	2	sand show oil	1122
lime	45	sand white fine	1133
shale	50	broken	1146
lime	55	white sand	1201
shale	62	chert	1203
lime	64	lime Brown Miss.	1211
shale	145	Total Depth	
lime	157		
shale dark	160	Estimated 2,000,000 gas 1055-1076	
lime	170		
shale light	175	After drilling to 1211 attempted	
lime shells	185	to plug back and save gas well - could	
shale dark water	190	not shut off water. Well abandoned - plugged.	
lime	198		
shale	205		
lime shells	215		
shale	220		
lime	270		
shale dark	275		
shale light	320		
lime	324		
shale	350		
lime shells	360		
shale sandy	365		
lime 200 water	420		
lime	435		
shale black water 7 BPH	439		
lime	445		
shale	450		
lime	467		
shale reduced hole 470	475		
lime broken	495		
lime	510		
shale	615		
lime shells	638		
lime	650		
shale	734		
lime	738		
shale	748		
lime brown	750		
lime	765		
shale gas	775		
shale light	790		
lime	810		
shale	815		
lime	820		
shale	825		
sand	835		
shale light-reduced to 6"	870		
840'			
shale	910		
905-910 black slate & gas			
shale	912		
lime	914		
shale dark	920		
shale light	930		
shale dark	1055		
gas sand	1076		
increased 1070-1073			
shale dark	1080		
sand broken water 6 BPH	1107		