

COMPANY

FARM Rose

NO. 2

SEC. 6 T. 27 R. 17E


LOC.

W1/2 NE 1/4 about 600'
fr S lease, 400' fr EL

COUNTY Wilson

TOTAL DEPTH 1025
COMM. 9-20-28 COMP. 10-2-28
SHOT OR TREATED
CONTRACTOR
ISSUED

KANSAS

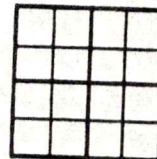

CASING

20 10
15 8
12 6
13 5

ELEVATION

PRODUCTION

FIGURES INDICATE BOTTOM OF FORMATIONS

soil, clay	5
shale	115
lime	140
shale	188
lime	223
shale	236
sand	254
shale	267
lime	273
shale	306
lime	380
shale	388
lime	416
shale	420
lime	444
shale	453
lime	484
shale	565
lime	580
shale	590
lime	600
shale	620
sand Little gas	636
shale	698
lime	724
shale	759
lime	774
shale	780
lime	784
shale	865
sand	970
<u>Oil- good show @ 930-70</u>	
shale	974
lime	976
shale	990
lime	995
shale	1018
sand	1025

Gas apparnetly in lime
on finish - might be
a good idea to go deeper
Total Depth

Copied from log strip.