


8-28-11 E

CHAMBERS & CHURCH.
Arnold No. 1.

SEC. 8 T. 28 R. 11E.
SW NW SE

Total Depth. 1231 P.B. 1228
Comm. 5-1-40 Comp. 5-31-40
Shot or Treated.
Contractor.
Issued. 2-8-41

County Greenwood.

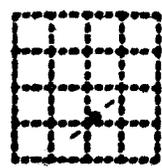

CASING.

12"	60'
10"	333'
8 1/4"	545'
6"	904'
5"	1202'

Elevation.

Production. DRY.

Figures Indicate Bottom of Formations.

soil	10	lime	756
lime	30	lime	795
shale	32	lime sdy	810
gravel	34 fresh wtr.	lime	890
shale	44	shale	1050
lime	76	lime	1052
shale	85	lime	1060
lime	90	shale	1085
shale	95	red rock	1095
lime	100	lime	1120
red rock	123	lime sdy	1152
lime	132	lime	1195
red rock	145	shale blk	1197
shale	165	lime brown	1199
lime	170	shale	1202
shale	180	lime	1216
lime	190	shale	1223 1/2
shale	200	lime brown	1227 Oil
sdyshale	205	lime Oil	1229
shale	225	lime water	1231
lime	228	Total Depth.	
shale	287		

wtr 295

sand	329 HFW	lime from 1203-16 show oil
shale	359	1212-16 no inc. oil
lime	365	1223 1/2-28 show oil
shale	375	
lime	385	
shale	395	
red rock	430	
shale	440	
lime	452	
shale	467	
red rock	480	
shale	495	
sand	540	
shale	545	
shale	635	
lime	640	
shale	662	
lime	669	
lime broken	675	
shale	746	

P.B. 1228
1500 gal acid. made 6 bbls oil and
5 bbls water.

plugged.