


Company- HILL & HILL  
Farm- Ireton

No. 1

SEC. 11 T. 32 R. 3E  
SW SW NE

11-32-3E  
County Cowley KANSAS

Total Depth. 3415 Corr. Schl.  
Comm. 9-8-52 Comp. 9-23-52  
Shot or Treated.  
Contractor. Watson Drlg. Co., Inc.  
Issued. 1-24-53

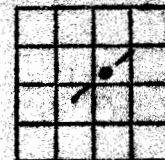

CASING:  
10 3/4" 86'

Elevation. 1185 K.R.

Production. Dry

Figures Indicate Bottom of Formations.

surface hole	86	lime & shale	3304
shale & lime	310	lime	3309
lime	330	shale	3333
lime & shale	485	shale & lime strks	3373
lime	510	shale & lime shells	3388
red rock	525	lime	3409
shale & lime	740	Corr. Sch. 3415	
red bed	750	Total Depth	
shale & lime shells	1155	Tops:	
lime & shale broken	1225	Layton	2496
sand & shale	1240	Kansas City	2554
lime & shale	1315	Miss.	3089
lime	1340	Arbuckle	3399
shale	1375		
lime	1420		
lime & shale strks	1510		
shale	1525		
lime	1610		
shale & sand	1640		
lime & shale	1680		
shale & sand	1710		
shale	1763		
lime	1776		
shale	1792		
lime	1820		
lime & shale	1954		
shale & sandy lime	2057		
lime brown & shale	2065		
sand hrd & shale	2125		
shale & sand	2158		
sandy lime & shale	2180		
shale	2268		
sand	2283		
shale	2318		
shale & lime strks	2369		
shale	2486		
sandy lime	2498		
sand	2509		
shale & sand	2559		
lime hrd	2565		
lime	2593		
sandy lime	2615		
sandy shale	2635		
lime	2754		
sandy shale	2783		
lime	2925		
shale & lime	3003		
shale & lime strks	3033		
red rock	3035		
		shale blue	3041
		shale	3085
		lime	3089
		lime wht	3107
		lime	3140
		lime brown	3174
		lime	3206
		shale brown & lime	3221
		lime	3237
		lime drk & shale	3279