

**TRILOBITE
TESTING INC.**

P.O. Box 1733 • Hays, Kansas 67601

Test Ticket

NO. 43806 15797

Well Name & No. ROSS D #4 BY: Test No. 1 Date 5-22-11
 Company Gore Oil Company Elevation 2146 KB 2138 GL
 Address PO Box 2757 Wichita KS 67202 4518
 Co. Rep / Geo. BOB Stoizle Rig Maverick 108
 Location: Sec. 7 Twp. 10 S Rge. 17 W Co. ROOKS State KS

Interval Tested 3367 - 3454 Zone Tested Lansing B-F zones
 Anchor Length 87 Drill Pipe Run 3368 Mud Wt. 9.0
 Top Packer Depth 3362 Drill Collars Run 0 Vis 600
 Bottom Packer Depth 3367 Wt. Pipe Run 0 WL 4.4
 Total Depth 3454 Chlorides 3900 ppm System LCM 2

Blow Description 1st - weak Blow Built to 3/4 IN
2nd - Dead No Blow Back
3rd - Dead No Blow
4th - Dead No Blow Back

Rec	Feet of	%gas	%oil	%water	%mud
15	Mud				

Rec Total 15 BHT 101 Gravity API RW @ ° F Chlorides ppm
 (A) Initial Hydrostatic 1663 ☒ Test 1125 T-On Location H-16 16:11
 (B) First Initial Flow 50 ☒ Jars 250 T-Started 16:26
 (C) First Final Flow 59 ☒ Safety Joint 75 T-Open 18:35
 (D) Initial Shut-In 753 ☐ Circ Sub T-Pulled 20:35
 (E) Second Initial Flow 54 ☐ Hourly Standby T-Out 22:04
 (F) Second Final Flow 57 ☒ Mileage 52 RT 72.80 Comments
 (G) Final Shut-In 629 ☐ Sampler
 (H) Final Hydrostatic 11651 ☐ Straddle
☐ Shale Packer
☐ Extra Packer
☐ Extra Recorder
☐ Day Standby
☐ Accessibility


Initial Open 30
 Initial Shut-In 30
 Final Flow 30
 Final Shut-In 30

Sub Total 1522.80

Approved By

Our Representative Jeff Brown

TriLOBITE TESTING INC. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

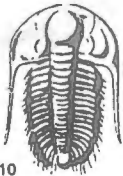

**TRILOBITE
TESTING INC.**

P.O. Box 1733 • Hays, Kansas 67601

Test Ticket

NO. 43807

Well Name & No. ROSS 0 #4 Test No. 2 Date 5-23-11
 Company Gore oil company Elevation 2146 KB 2138 GL
 Address PO Box 2757 Wichita KS 67202-4518
 Co. Rep / Geo. Bob Stolzle Rig Maverick 108
 Location: Sec. 7 Twp. 10 S Rge. 17 W Co. ROOKS State KS

Interval Tested 3508 - 3590 Zone Tested LKC-I-J-K-L zones
 Anchor Length 82 Drill Pipe Run 3494 Mud Wt. 9.0
 Top Packer Depth 3503 Drill Collars Run 0 Vis 56
 Bottom Packer Depth 3508 Wt. Pipe Run 0 WL 6.4
 Total Depth 3590 Chlorides 3300 ppm System LCM 2

Blow Description FFP-weak Blow Built TO 2 1/4 IN
ISI-Dead NO Blow Back
FFP-weak Blow Built TO 3/4 IN
ISI-Dead NO Blow Back

Rec	Feet of	%gas	%oil	%water	%mud
<u>38</u>	<u>USOC m</u>		<u>2</u>		<u>98</u>
<u>38</u>	<u>mud with a scum of oil</u>				<u>100</u>

Rec Total 48 BHT 104 Gravity _____ API RW _____ @ _____ °F Chlorides _____ ppm

(A) Initial Hydrostatic	<u>1762</u>	☒ Test	<u>1125</u>	T-On Location	<u>15:44</u>
(B) First Initial Flow	<u>50</u>	☐ Jars		T-Started	<u>16:11</u>
(C) First Final Flow	<u>57</u>	☒ Safety Joint	<u>75</u>	T-Open	<u>17:44</u>
(D) Initial Shut-In	<u>805</u>	☐ Circ Sub		T-Pulled	<u>20:44</u>
(E) Second Initial Flow	<u>60</u>	☐ Hourly Standby		T-Out	<u>22:17</u>
(F) Second Final Flow	<u>64</u>	☒ Mileage	<u>52 RT 72.80</u>	Comments	
(G) Final Shut-In	<u>757</u>	☐ Sampler			
(H) Final Hydrostatic	<u>1748</u>	☐ Straddle			

Initial Open	<u>30</u>	☐ Ruined Shale Packer	
Initial Shut-In	<u>45</u>	☐ Ruined Packer	
Final Flow	<u>45</u>	☐ Extra Copies	
Final Shut-In	<u>40</u>	Sub Total	<u>0</u>
		Total	<u>1272.80</u>
		MP/DST Disc't	
		Sub Total	<u>1272.80</u>

Approved By _____ Our Representative Jeff Brown
 TriLOBITE Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.