


KANSAS GEOLOGICAL SOCIETY  
508 East Murdock  
Wichita, Kansas

# DREILING OIL, INC.

Victoria, Kansas 67671

KANSAS

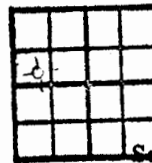

SE SW NW  
13-10-26W

API-15-179-20,311  
Sec. 13 Twp. 10 Rng. 26

~~JUN 23 1972~~ Oil, Inc.

## WELL LOG

Route #2  
Victoria, KS 67671

Company

Farm Gano No. 2

Location SE SW NW

Total Depth 4080'

County Sheridan

Comm. 6-5-72 Comp. 6-11-72

Elevation: 2591' K. B.

Contractor Dreiling Oil, Inc.  
Victoria, Kansas 67671

2588' D. F.

2586' G. R.

Casing Record

Cement Record

Production:

253' - 8 5/8"

165 sacks cement

D & A


Figures Indicate Bottom of Formations

0'	160'	Top Soil, Sand
160'	165'	Yellow Clay
165'	253'	Blue Shale
253'	400'	Shale
400'	1395'	Shale, Sand
1395'	1810'	Shale
1810'	1990'	Sand
1990'	2050'	Red Bed, Shale
2050'	2221'	Shale
2221'	2259'	Anhydrite
2259'	2615'	Shale, Lime Streaks
2615'	3139'	Shale
3139'	3725'	Shale, Lime
3725'	4080'	Lime
4080'	T.D.	

### LOG TOPS

SC 2222  
 B SC 2254  
 TOP 3591 ss  
 HEEB 3804  
 TOR 3827  
 LANS 3845  
 BKC 4072  
 LTD 4080  
 RTD 4080

Secretary Treasurer, of Dreiling Oil, Inc. upon  
the above and foregoing is a true and correct copy  
of the well log and Drilling Report from the Gano #2.

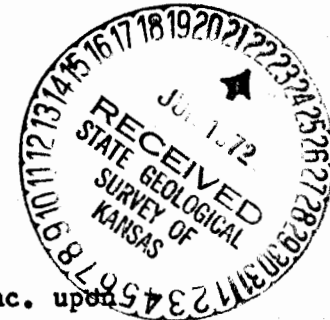

Joe Hess  
JOE HESS

Subscribed and sworn to before me this 13th day of June, 1972.



Patty Rohr  
PATTY ROHR NOTARY PUBLIC