

Plotted Texas CO.

MARGAY OIL COMPANY.  
 Bemis No. 3-B


SEC. 15 T. 11 R. 17W.  
 SW NW SW

*Plotted  
 O.S.*

County Ellis.

Total Depth. 3401  
 Comm. 9-2-36 Comp. 10-3-36  
 Shot or Treated.  
 Contractor.  
 Issued. 12-12-36

DEC 12 1936

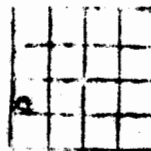

CASING.

15 1/2" 99 7" 3395'  
 10 3/4" 1096

Elevation.

Production. Pot. 11965.

Figures Indicate Bottom of Formations.

surface clay and shells	99	broken lime	2260
shale grey	120	lime	2280
shale and shells	388	red rock	2285
pyrites of iron	406 ✓	shale	2330
red rock	442	shale and shells	2371
red bed	472	broken lime	2495
shale and shells	502	limo	2498
lime	520	shale and shells	2595
shale and hard shells	574	lime	2603
sand red rock	584	sticky blue shale	2612
shale and shells	620	slate and shells	2659
sand	670	shale and shells	2666
red rock	821	lime	2696
sticky red bed	912	broken lime and shale	2721
red rock	1000	broken lime	2730
red bed sticky	1048	limo	2745
red bed	1090	shale	2768
anhydrite	1096	slate	2773
anhydrite and lime	1148	lime	2794
shale and shells	1260	shale	2803
red bed and shale breaks	1445	shale and shells	2848
shale	1448	lime hard	2876
salt and shale	1609	lime	3160
salt	1652	broken limo and shale	3170
lime	1661	limo	3200
shale and shells	1703	broken lime	3226
lime hard	1735	lime hard	3252
broken lime	1761	lime	3277
lime	1785	lime shale banks	3306
shale	1833	lime	3375
lime	1854	conglomerate	3391
broken lime and shale	1915	shale green	3395
shale and lime shells	1951	lime	3401
lime	1980		
red rock	1985	Total Depth.	
shale	2004		
broken lime	2043		
lime	2097		
lime broken	2155		
lime	2248		