

WELL LOG BUREAU - KANSAS GEOLOGICAL SOCIETY.
412 Union National Bank Bldg, Wichita, Kansas.


PLOTTED
G. E. Jamison

MARGAY OIL CO.
Bomis No. 7-C.

SEC. 22 T. 11 R. 17W.
SE NE SW

Total Depth. 3474
Comm. 6-5-37 Comp. 6-27-37
Shot or Treated.
Contractor.
Issued. 9-4-37

County Ellis

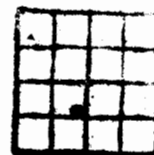

CASING.

15 $\frac{1}{2}$ " 32
10" 1218'
7" 3474'

Elevation.

Production. Pot. 2649B.

Figures Indicate Bottom of Formations.

cellar	10	broken limo	2106
surface clay	32	limo	2250
clay and shale	310	broken limo	2332
shale and shells	602	limo	2362
sand	676	shale	2371
iron and pyrites	686	limo	2539
shale and shells	775	shale	2542
sand	855	limo	2585
shale and shells	930	broken limo	2649
sand	945	shale	2700
shale	1040	sticky blue shale	2714
sand	1080	sticky shale	2730
shale and shells	1146	broken limo	2767
red rock and shale	1194	shale sticky	2771
chalk	1198	limo	2885
anhydrite	1203	shale and limo	2986
SLM corr. 1203 equals 1218		limo	3185
anhydrite	1249	limo broken	3315
limo	1269	limo	3340
red rock	1314	SLM corr. 3340 equals 3354	
limo and shale	1393	limo	3474
limo	1440	Total Depth.	
red rock and shale	1575		
shale and shells	1590		
salt	1731		
shale and shells	1842		
limo broken	1910		
limo	2036		