

23-11-17-2077ED
P.E.f.

WELL LOG BUREAU - KANSAS GEOLOGICAL SOCIETY
412 Union National Bank Bldg, Wichita, Kansas.


KERLYN OIL CO.
Rumsey No. 5

SEC. 23 T. 11 R. 17W.
NE SW SW

Total Depth. 3420
Comm. 6-1-38 Comp. 6-30-38
Shot or Treated.
Contractor.
Issued. 8-6-38

AUG 6 1938

County Ellis.

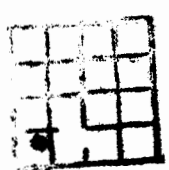

CASING.

10" 1152' 7" 3415'

Elevation.

Production. Pot. 3195 B.

Figures Indicate Bottom of Formations.

surface	40
shale	220
shale and shells	490
shale	528
sand	610
lime	622
pyrite	630 ✓
shale and sand	740
shale and lime	923
shale and lime shells	1050
shale and sand	1160
lime	1180
red bed and shells	1390
shale and shells	1596
salt and red rock	1771
lime	1901
red rock	1975
sand and lime	2006
lime	2112
broken lime, red rock and shale	2185
lime and shale	2245
lime	2285
lime and shale	2471
shale lime shells	2543
lime and shale	2638
shale	2658
lime	2670
lime and shale	2725
lime	2845
lime and shale	2885
lime	3420
Total Depth.	