

WELL LOG BUREAU - KANSAS GEOLOGICAL SOCIETY.
412 Union National Bank Bldg, Wichita, Kansas.

SHELL PETROLEUM CORP.
J.L. Rumsey No. 12.


SEC. 23 T. 11 T. 17W.
SW SE NW
330' SL. 982' EL. NW $\frac{1}{4}$

Total Depth. 3390
Comm. 9-10-38 Comp. 10-2-38
Shot or Treated.
Contractor. Corbett and Barbour.
Issued. 11-12-38

County. Ellis.

NOV 12 1938

CASING. Rotary 3372
Cable 3390

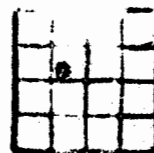

16" 129'
103/4" 1095'
7" 3371'

Elevation.

Production. Pot. 3321 B.
no water

FIGURES INDICATE BOTTOM OF FORMATIONS.

surface rock shale and		poor oil stain	3088-97
sand	132	good oil stain	3115-23
iron broken	162 ✓	poor oil stain	3180-84
shale	300	broken limo	3112
red rock	421	limo	3327
shale	470	conglomerate	3349
sand	570	dolomite	3357
iron	577 ✓	shale green	3364
shale	660	sand	3366
sand	740	fair porosity and some oil	
red rock	789	stain	
red bed	810	shale green	3370
shells and sand	850	3375- 3372' SLC.	
shale	900	dolomite	3390
lime shells & shale	975		
sand and shells	1035	Total Depth.	
shale	1082	2900' oil 3372	
anhydrite	1100		
anhydrite	1130		
red bed	1360		
shale and shells	1445		
shale and salt	1525		
salt	1650		
shale and shells	1790		
lime	1878		
shale and shells	1970		
lime	2133		
broken limo	2200		
shale	2215		
broken limo	2240		
shale and shells	2275		
broken limo	2550		
shale and shells	2600		
broken limo	2610		
shale	2665		
broken limo	2804		
lime	2908		
lime	2955		
short and limo	2984		
lime	3072		
good stain	3024-27		
Trace oil stain	3063-73		