

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

RECEIVED
MAR 08 2010

Test Ticket

NO. 37057

13985

Well Name & No. Clark Unit 1-26 Test No. 1 Date 3-3-10
 Company Brito Oil Company Elevation 3092 KB 3087 GL
 Address 1700 N Waterfront Pkwy Wichita, KS 67206
 Co. Rep / Geo. Tom Funk Rig Murfin #8
 Location: Sec. 26 Twp. 12S Rge. 33W Co. Logan State KS

Interval Tested 4234 4290 Zone Tested Lensing I-J
 Anchor Length 56 Drill Pipe Run 4047 Mud Wt. 8.7
 Top Packer Depth 4229 Drill Collars Run 182 Vis 54
 Bottom Packer Depth 4234 Wt. Pipe Run — WL 6.4
 Total Depth 4290 Chlorides 1700 ppm System LCM 2

Blow Description IF: 1/4 blow built to 1 in 30 min.
IS: No return.
FF: surface blow built to 1/4 in 30 min.
FS: No return.

Rec	Feet of	%gas	%oil	%water	%mud
<u>20</u>	<u>mud</u>			<u>100</u>	
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud

Rec Total 20 BHT 110 Gravity — API RW — @ — °F Chlorides — ppm

(A) Initial Hydrostatic 2098 ☒ Test 1150.00
 (B) First Initial Flow 11 ☐ Jars —
 (C) First Final Flow 19 ☐ Safety Joint —
 (D) Initial Shut-In 1123 ☒ Circ Sub N/C
 (E) Second Initial Flow 21 ☐ Hourly Standby —
 (F) Second Final Flow 27 ☒ Mileage 92-92.00
 (G) Final Shut-In 1118 ☐ Sampler —
 (H) Final Hydrostatic 2051 ☐ Straddle —

T-On Location 3:00
 T-Started 4:20
 T-Open 6:33
 T-Pulled 8:33
 T-Out 11:10
 Comments —


Initial Open 30 ☐ Shale Packer —
 Initial Shut-In 30 ☐ Extra Packer —
 Final Flow 30 ☐ Extra Recorder —
 Final Shut-In 30 ☐ Day Standby —
☐ Accessibility —
 Sub Total 1242

☐ Ruined Shale Packer —
☐ Ruined Packer —
☐ Extra Copies —
 Sub Total 0
 Total 1242

Approved By [Signature]

Our Representative [Signature]

TriLOBITE TESTING INC. shall not be liable for damaged or any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test. Tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

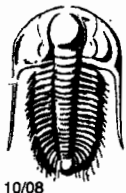

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

RECEIVED
MAR 08 2010

Test Ticket

NO. 37058

Well Name & No. Clark unit 1-26 Test No. 2 Date 3-4-10
 Company Brito oil company Elevation 3092 KB 3087 GL
 Address 1700 N Waterfront PKWY W:chit9, KS 67206
 Co. Rep / Geo. Tom Funk Rig Martin 8
 Location: Sec. 26 Twp. 125 Rge. 33W Co. Logan State KS

Interval Tested 4473 4555 Zone Tested Pawnee - Ft. Scott
 Anchor Length 82 Drill Pipe Run 4301 Mud Wt. 9.3
 Top Packer Depth 4468 Drill Collars Run 182 Vis 50
 Bottom Packer Depth 4473 Wt. Pipe Run — WL 7.6
 Total Depth 4555 Chlorides 2000 ppm System LCM 1

Blow Description IF: 1/4 blow died in 15 min.
IS: No return.
EF: No blow.
FS: No return.

Rec	Feet of	%gas	%oil	%water	%mud
<u>10</u>	<u>mud some oil spots</u>			<u>160</u>	
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud

Rec Total 10 BHT 112 Gravity — API RW — @ — ° F Chlorides — ppm

(A) Initial Hydrostatic 2230
 (B) First Initial Flow 12
 (C) First Final Flow 19
 (D) Initial Shut-In 820
 (E) Second Initial Flow 21
 (F) Second Final Flow 26
 (G) Final Shut-In 558
 (H) Final Hydrostatic 2191

☒ Test 1150.00
☐ Jars —
☒ Safety Joint —
☒ Circ Sub NIC
☐ Hourly Standby —
☒ Mileage 92.00
☐ Sampler —
☐ Straddle —
☐ Shale Packer —
☐ Extra Packer —
☐ Extra Recorder —
☐ Day Standby —
☐ Accessibility —
 Sub Total 1242-

T-On Location 9:00
 T-Started 10:05
 T-Open 12:22
 T-Pulled 16:50
 T-Out —
 Comments —
—
—
☐ Ruined Shale Packer —
☐ Ruined Packer —
☐ Extra Copies —
 Sub Total 0
 Total 1242-

Initial Open 30
 Initial Shut-In 30
 Final Flow 30
 Final Shut-In 30

Approved By [Signature]

Our Representative [Signature]

TriLOBITE TESTING INC. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test. tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.