

15-051-04046

MILLER-DONELSON

10-13s-17w

GEORGE MILLER
PHONE 3370
GREAT BEND, KANSAS

JIM DONELSON
PHONE 4-2717
HAYS, KANSAS

TESTING COMPANY

P. O. BOX 547

GREAT BEND, KANSAS


TEST NO. 2

TICKET NO. 1231

COMPANY K. F. E. Drilling Co. WELL Gaibler #1
 DEPTH 3362' BOTTOM HOLE MUD PRESSURE 1900 #
 CHOKES - TOP 1/2" BOTTOM 1/2" SURFACE PRESSURE 0
 BOTTOM PRESSURE 0 IFP 0 FFP 60 # SHUT-IN 700 #
 TESTED FROM 3326' TO 3362' DATE 3-31-56

RECOVERY:


150' watery mud w/ specks of oil

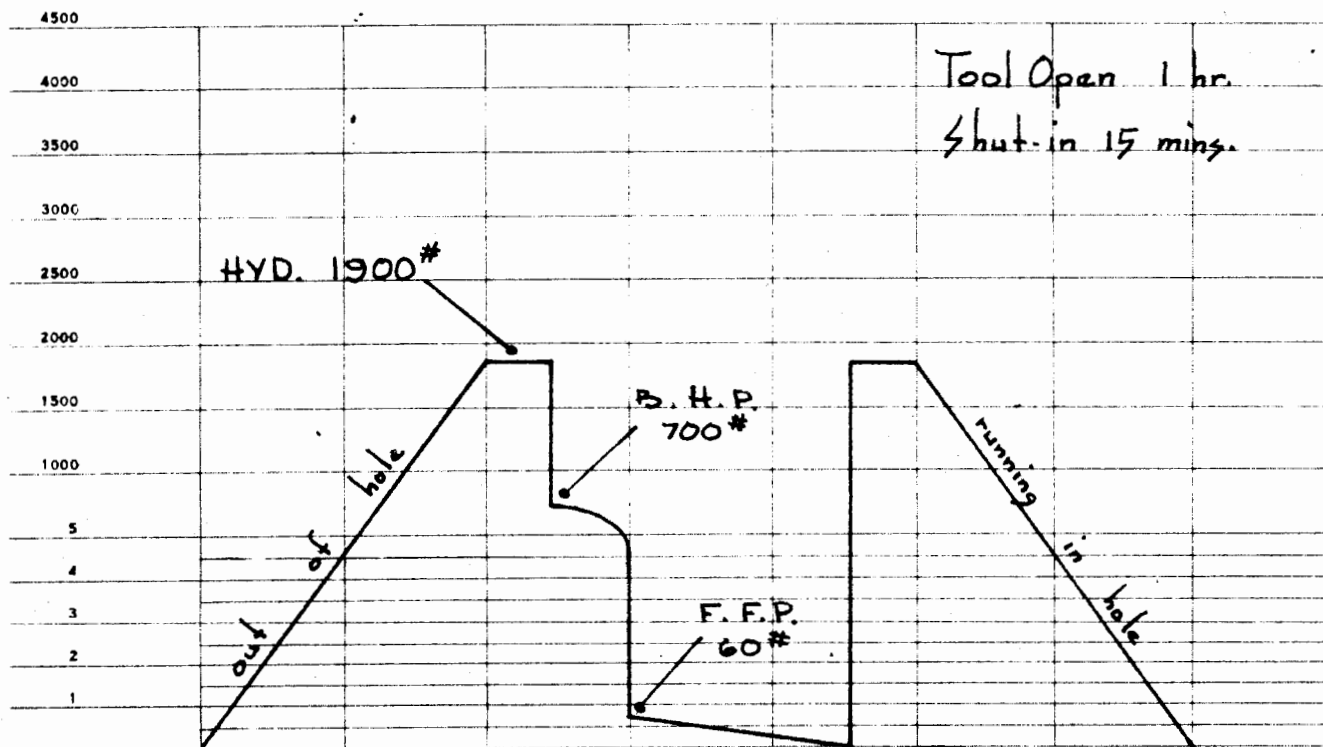


BEE INFORMATION TESTING COMPANY

SUB-SURFACE RECORD

COMPANY K & E Drilling Inc DATE OF TEST 4-2-56
WELL NO. 1 TEST NO. 3 LEASE Geibler
PRESSURE RECORDER CAP 2500# & 3000# MUD WT. 10.6#
TOTAL DEPTH 3524' PACKER SET AT 3519'
RECOVERY 8' mud
BLOW: Weak for 4 minutes - By passed tool-Weak for 1 minute
FORMATION TESTED: Arbuckle
TOOL OPEN: 30 minutes
CHOKE SIZE: TOP 1/2" BOTTOM 1/2" NO. OF COPIES 1
OPERATOR Wm. M. Blake TEST TICKET NO. 1467
SHUT IN PRESSURE TIME 15 minutes BHP 0 IFP 0 FFP 0 MUD COLUMN PRESSURE 1950#
PACKER SEAT FAILURE _____ TOOL PLUGGED _____ ANCHOR PLUGGED _____

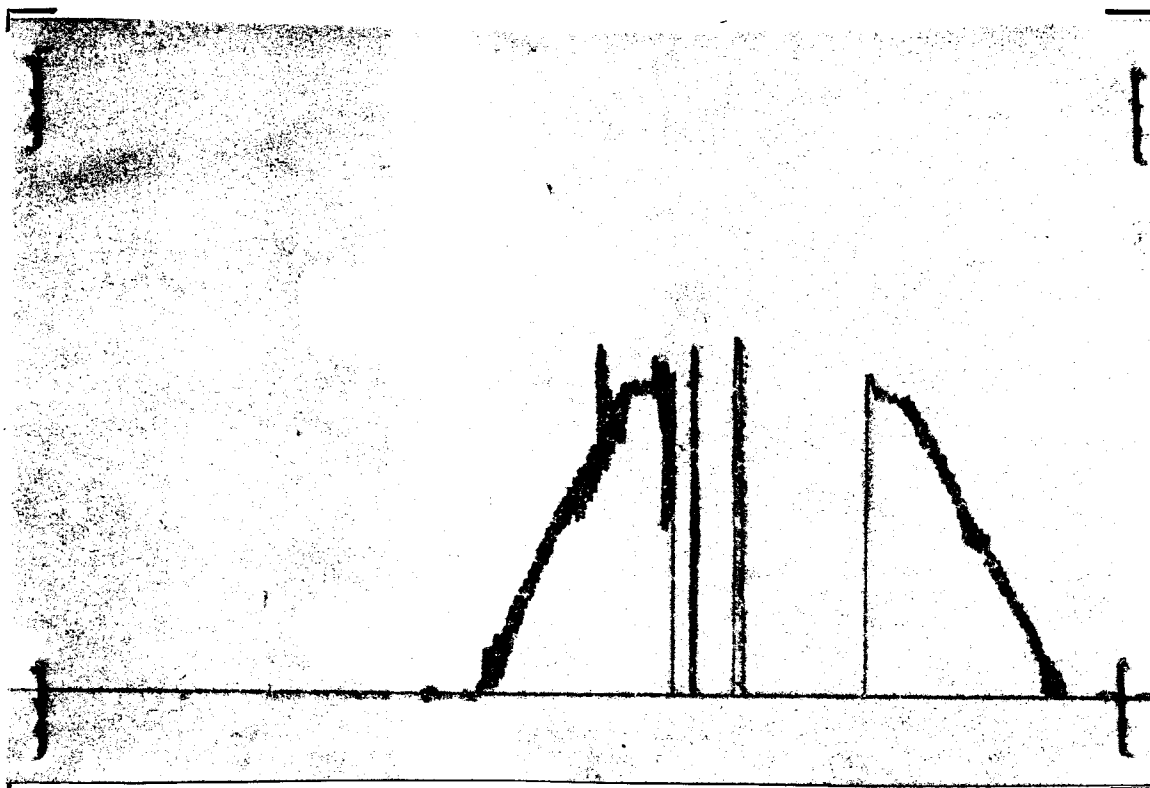

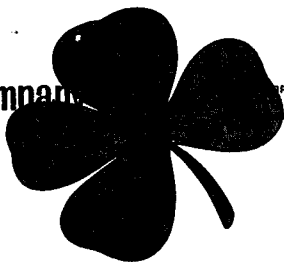

Hays Office 4-2380

AMherst 2-4421

TEST TICKET

Date APRIL-2-1956 Area or Field EAST OF CATHERN
Charge to KYE DRILL CO. Owner of Well KYE DRILL CO.
Mailing Address 1006-CENTRAL BLDG Contractor KYE
City and State WICHITA KANS. Rig. No. 1

Well No. 1 Lease GIEBLER County ELLIS Sec. 10 Twp. 13 Rg. 17
Test No. 104 Size Hole 7 3/8 Well Depth 3527 Size Drill Pipe 4 1/2 FH
No. Packers 2 DUALS Size Packer 6 3/4 Set at 3570
Size of Rat Hole 7 3/8 Length of Anchor 7'
Kind of Test Tool Used BAR DROP


Test Results:


Time Tool Opened 9:11 A.M Amt. of Time Tool Open 30 MIN
Shut in Pressure Time 15 MIN Shut in Pressure 76 #
Initial Flow Pressure 0 Final Flow Pressure 0
Was Shut in Pressure Still Building? YES HDY HD-1980#
Description of Blow VERY WEAK FOR 10 MIN) BY PASSED TOOL WIRE
Recovery: 15' OF MUD FEW SPECIES OF OIL FOR 2 MIN

Was tool flushed? YES Was tool plugged? NO Was Anchor plugged?
Mud Weight 10.6 Mud Viscosity 38 Water Loss 12.2
Was Hole Filled During Test? YES Were Packer Rubbers Damaged? NO
Extra Equipment Used NONE

The above job was done, and all tools were used under the exclusive control, direction and supervision of the owner, operator or his agent whose signature appears below. Clover Leaf Testing, Inc., shall not be liable for damage of any kind to the property or the personnel of the one for whom a test is made or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statement or opinion concerning the result of any test. Tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

Test Operator: Elmer F. Roberts Test Approved By: W. L. Emigan

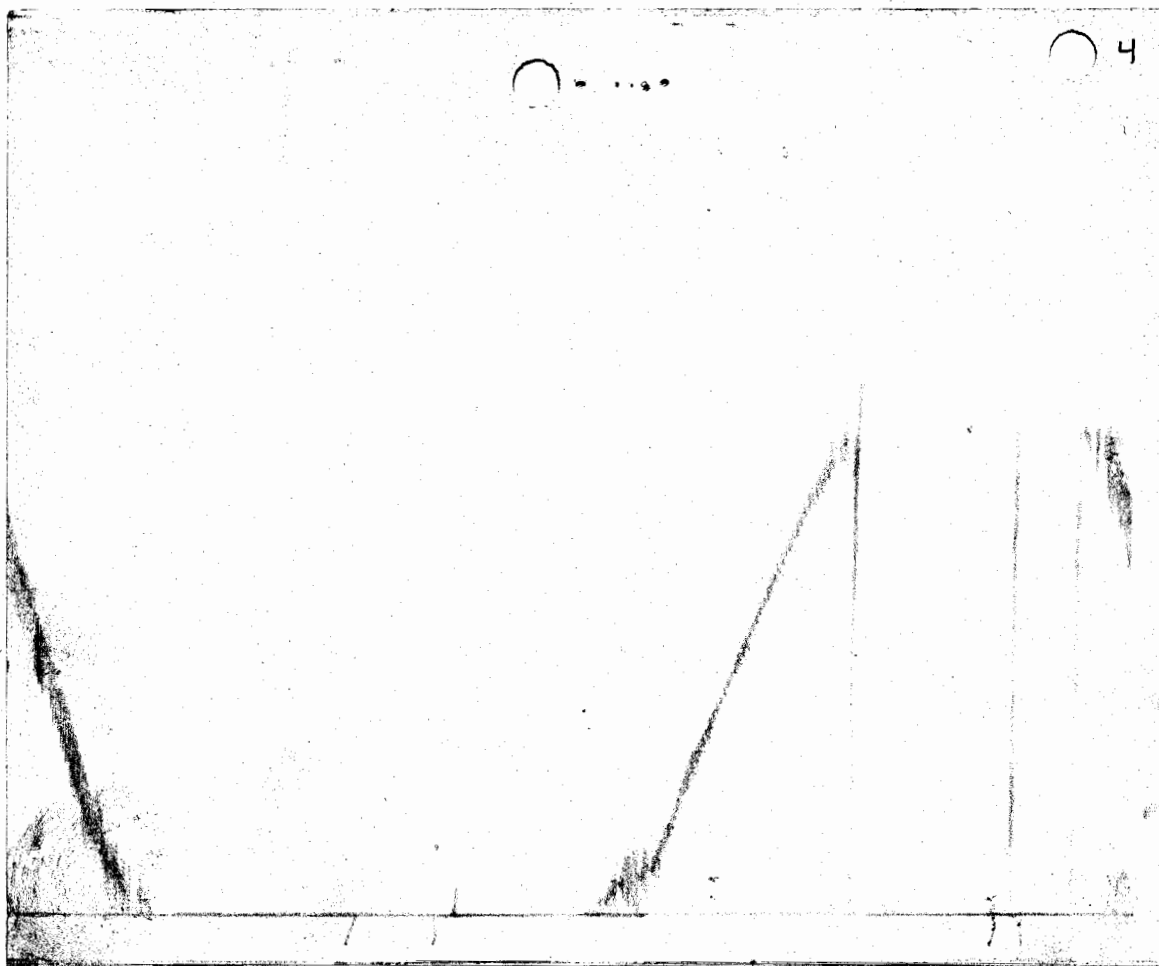

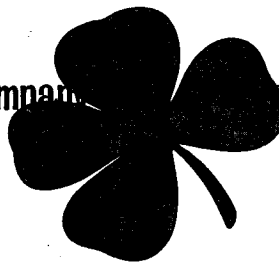

Hays Office 4-2380

AMherst 2-4421

TEST TICKET

Date MARCH, 30, 1956 Area or Field _____
 Charge to KYE DRILL CO Owner of Well KYE
 Mailing Address 1006 CENTRAL BLDG Contractor KYE
 City and State WICHITA KANS. Rig. No. 7

Well No. 1 Lease GEIBLER County ELLIS Sec. 10 Twp. 13 Rg. 17
 Test No. #1 Size Hole 7 7/8 Well Depth 3195 Size Drill Pipe 4 1/2 F.H.
 No. Packers 2 DUALS Size Packer 6 3/4 Set at 3175
 Size of Rat Hole 7 7/8 Length of Anchor 20'
 Kind of Test Tool Used BAR DROP

Test Results:
 Time Tool Opened 12:19 P.M. Amt. of Time Tool Open 45 MIN
 Shut in Pressure Time 15 MIN Shut in Pressure 1050#
 Initial Flow Pressure 0 Final Flow Pressure 0
 Was Shut in Pressure Still Building? HDY HD. - 1790#
 Description of Blow WEAK FOR 6 MIN BYPASSED TOOL WEAK FOR 5 MIN
 Recovery: 80' OF MUD

Was tool flushed? YES Was tool plugged? _____ Was Anchor plugged? _____
 Mud Weight 10.6 Mud Viscosity 37 Water Loss 18
 Was Hole Filled During Test? YES Were Packer Rubbers Damaged? NO
 Extra Equipment Used NONE

The above job was done, and all tools were used under the exclusive control, direction and supervision of the owner, operator or his agent whose signature appears below. Clover Leaf Testing, Inc., shall not be liable for damage of any kind to the property or the personnel of the one for whom a test is made or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statement or opinion concerning the result of any test. Tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

Test Operator: Chas F. Roberts Test Approved By: W. L. Brinegar

A Ticket Must Be Made With Complete Information For Each Run, Whether Successful or Not

