


2DBØ ✓

TEST PILE MONITORING REPORT

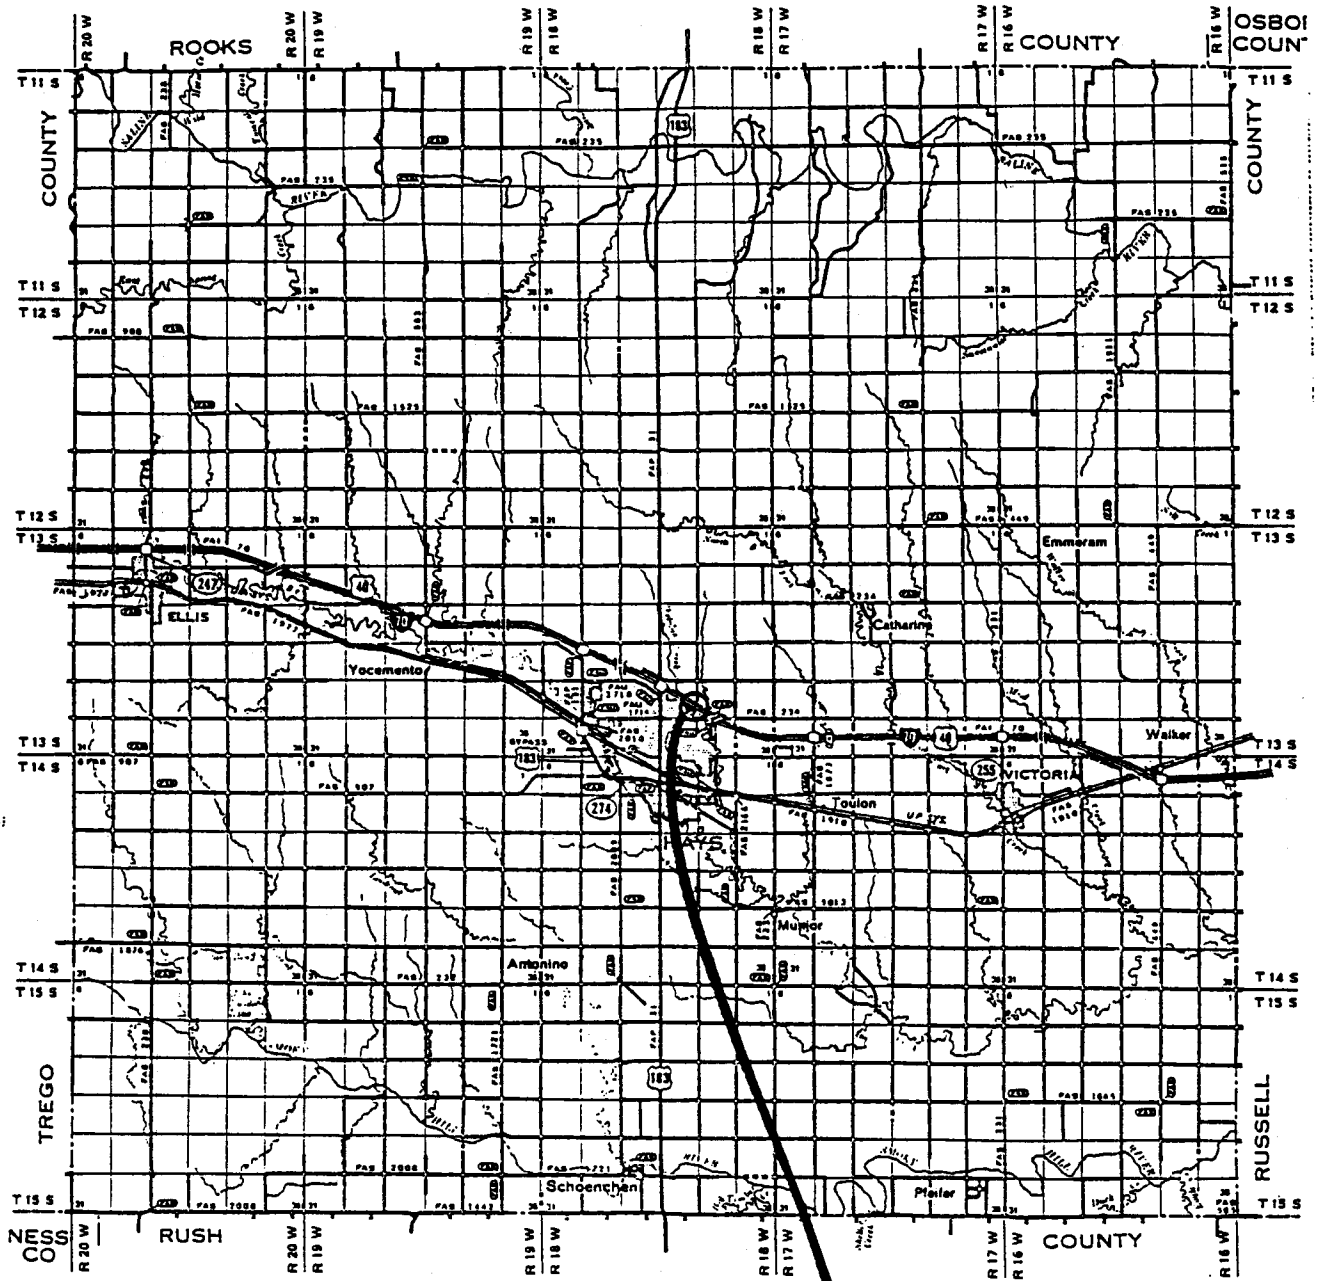

70-26 K-4440-01
Commerce Parkway over I-70
Bridge No. 17.93, Station 50+00
Ellis County

KANSAS DEPARTMENT OF TRANSPORTATION



1. ROUTE-COUNTY NO. <u>070-026</u>	7. SOUNDING NO. <u>1</u>	12. SHEET <u>1</u> OF <u>1</u>
2. BRIDGE STA. <u>50+00</u>	8. PROJECT NO. <u>K-4440</u>	13. BRIDGE NO. <u>17.93</u>
3. DESCRIPTION <u>I-70/Commerce Parkway Interchange</u>		14. HOLE STA. <u>48+44.4-5'</u>
4. GEOLOGIST <u>P. Hutchinson</u>	9. VERTICLE SCALE <u>1"=10'</u>	15. DATE <u>6-15-1993</u>
5. DRILLER <u>B. Bergman</u>	10. RIG <u>Mobil, B-61</u>	16. ELEVATION TOP OF HOLE <u>2030.9</u>
6. GROUND WATER ELEV. <u>2021.4</u>	11. TOTAL DEPTH OF HOLE <u>26.7</u>	17. ELEVATION TOP OF ROCK

BIT TYPE & NO.	GEOLOGIC NAME	STRATIGRAPHIC COLUMN	DEPTH	ELEVATION	CLASSIFICATION OF MATERIALS DESCRIPTION AND REMARKS	UNCONFINED COMPRESSION	STANDARD PENETRATION OR CASING DRIVE	
							BLOWS	ELEV.
	Alluvium			2030	2030.9	Sa#1	Qu 3.81	2028.8
						Sa#2	No Qu	2023.9
						Sa#3	Qu 0.29	2018.9
						Sa#4	Qu 0.59	2016.9
						Sa#5	No Qu	2015.7
	Blue Hill Shale Member			2010	Shale, clayey, tannish gray -		22	2010.4
					2004.2		31	2006.3