

**TRILOBITE
TESTING INC.**

P.O. Box 1733 • Hays, Kansas 67601

Test Ticket

NO. 042566 15748

BY: _____

Well Name & No. BeFort 1-12 Test No. 1 Date 5-10-11
 Company DNOC Elevation 2178 KB 2170 GL
 Address PO Box 619 Hays, K 67601
 Co. Rep / Geo. Gator Rig Discovery 4
 Location: Sec. 12 Twp. 14 Rge. 19 Co. Ellis State K

Interval Tested 3427-3483 Zone Tested _____
 Anchor Length 56 Drill Pipe Run 3409 Mud Wt. 8.6
 Top Packer Depth 3422 Drill Collars Run 31 Vis 79
 Bottom Packer Depth 3427 Wt. Pipe Run _____ WL 8.0
 Total Depth 3483 Chlorides 1000 ppm System LCM _____

Blow Description IFP- BOB 29 min
ISI- no blow back
FFP- weak to Good blow 1/4" - 7"
F-SI- no blow back

Rec	Feet of	%gas	%oil	%water	%mud
<u>150</u>	<u>GIP</u>				
<u>65</u>	<u>HOCM</u>		<u>35</u>		<u>65</u>
Rec _____	Feet of _____	%gas	%oil	%water	%mud
Rec _____	Feet of _____	%gas	%oil	%water	%mud
Rec _____	Feet of _____	%gas	%oil	%water	%mud

Rec Total 65 BHT 105 Gravity _____ API RW _____ @ _____ °F Chlorides _____ ppm

(A) Initial Hydrostatic 1642
 (B) First Initial Flow 35
 (C) First Final Flow 47
 (D) Initial Shut-In 308
 (E) Second Initial Flow 44
 (F) Second Final Flow 57
 (G) Final Shut-In 315
 (H) Final Hydrostatic 1634

☒ Test 1125
☐ Jars _____
☐ Safety Joint _____
☐ Circ Sub _____
☐ Hourly Standby _____
☒ Mileage 16 RT 22.40
☐ Sampler _____
☐ Straddle _____
☐ Shale Packer _____
☐ Extra Packer _____
☐ Extra Recorder _____
☐ Day Standby _____
☐ Accessibility _____
 Sub Total 1147.40

T-On Location 2216
 T-Started 2348
 T-Open 0137
 T-Pulled 0437
 T-Out 0609
 Comments 2' fill on bottom

Initial Open 45
 Initial Shut-In 45
 Final Flow 45
 Final Shut-In 45


☐ Ruined Shale Packer _____
☐ Ruined Packer _____
☐ Extra Copies _____
 Sub Total 0
 Total 1147.40
 MP/DST Disc't _____

Approved By _____

Our Representative

Brian Fairbank

TriLOBITE TESTING INC. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

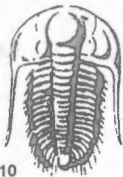

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

Test Ticket

NO. 042567

RECEIVED
MAY 13 2011

Well Name & No. Befert 1-12 Test No. 2 Date 5-12-11
 Company ONOC Elevation 2178 KB 2170 GL
 Address _____
 Co. Rep / Geo. Gater Rig Discovery 4
 Location: Sec. 12 Twp. 14 Rge. 19 Co. Ellis State KS

Interval Tested 3743-3793 Zone Tested _____
 Anchor Length 50 Drill Pipe Run 3721 Mud Wt. 8.9
 Top Packer Depth 3738 Drill Collars Run 31 Vis 59
 Bottom Packer Depth 3743 Wt. Pipe Run _____ WL 8.0
 Total Depth 3793 Chlorides 2000 ppm System LCM _____
 Blow Description IFP - sur blow - died 14 min
ISI - no blow back
FFP - no blow
FSI - no blow back

Rec <u>5</u>	Feet of <u>SOCM</u>	%gas <u>5</u>	%oil	%water <u>95</u>	%mud
Rec _____	Feet of _____	%gas	%oil	%water	%mud
Rec _____	Feet of _____	%gas	%oil	%water	%mud
Rec _____	Feet of _____	%gas	%oil	%water	%mud
Rec _____	Feet of _____	%gas	%oil	%water	%mud

Rec Total 5 BHT 113 Gravity _____ API RW _____ @ _____ °F Chlorides _____ ppm
 (A) Initial Hydrostatic 1862 ☒ Test 1125 T-On Location 0151
 (B) First Initial Flow 31 ☐ Jars _____ T-Started 0214
 (C) First Final Flow 32 ☐ Safety Joint _____ T-Open 0354
 (D) Initial Shut-In 170 ☐ Circ Sub _____ T-Pulled 0554
 (E) Second Initial Flow 35 ☐ Hourly Standby _____ T-Out 0725
 (F) Second Final Flow 34 ☒ Mileage 110 RT 22.40 Comments 5' fill on bottom
 (G) Final Shut-In 81 ☐ Sampler _____ mileage to bsd bcl
 (H) Final Hydrostatic 1841 ☐ Straddle _____ ☐ Ruined Shale Packer _____

Initial Open 30 ☐ Shale Packer _____
 Initial Shut-In 30 ☐ Extra Packer _____
 Final Flow 30 ☐ Extra Recorder _____
 Final Shut-In 30 ☐ Day Standby _____
 Sub Total 1147.40 ☐ Accessibility _____
 MP/DST Disc't _____

Approved By _____ Our Representative Brian Fairbank

Trilobite Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.