

503 East Murdock
Wichita, Kansas

AUG 28 1971

ROTARY DRILLING LOG

35-15-2640
C NW NE

COMPANY: Pickrell Drilling Company
705 Fourth National Bank Building
Wichita, Kansas 67202
LOCATION: Chapman "C" No. 1, C NW NE Sec. 35-15S-26W.
Gove County, Kansas

Rotary Drilling Commenced 8/22/71

Rotary Drilling Completed 9/2/71


Elevation: 2545' KB

CONTRACTOR: PICKRELL DRILLING COMPANY
Wichita, Kansas

DRY/MISS

CASING RECORD: Run 6 Jts. 8 5/8" surface casing set @ 242' K.B. Cemented with 130 sacks cement. Completed 7:45 P.M. Circulated.

No oil string run. D & A, Plugged 10 A.M. September 2, 1971.

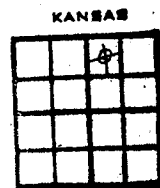

LOG

(Figures indicate bottom of formation — measurements from top of rotary bushing.)

		C. F. S.
60	Surface Soil - Gravel	3940
900	Shale	3950
950	Sand	3960
1110	Shale	4010
1200	Hard Sand	4042
1389	Shale - Red Beds	4075
1405	Blain	4100
1480	Red Beds & Shale	4370
1610	Sand	4487
1735	Sand & Shale	4510
1968	Shale	
2030	Anhydrite	
2500	Shale & Lime	
3325	Lime	
3795	Shale & Lime	
4487	Lime	
4495	Mississippi	
4510	Mississippi Lime, RTD	

S.L.M.

Pipe strapped at 3890'
1.81' short to the board

LOG TOPS:

Stone Corral	1964
Heebner	3785
Toronto	3804
Lansing	3826
Kansas City	3996
Stark	4069
BKC	4128
Ft Scott	4339
Cher	4365
Cong	4428
Mississippi	4450
" Dol	4468

Slope Tests

1500
2000
2500
3000
3500
4000
4500

The undersigned, C. W. Sebitts, Attorney-in-Fact for PICKRELL DRILLING COMPANY, hereby certifies in behalf of said Company, that the above is a true and correct log of the formation encountered in drilling above well as reflected by the Daily Drilling Reports.