

WELL LOG BUREAU - KANSAS GEOLOGICAL SOCIETY.
412 Union National Bank Bldg, Wichita, Kansas

Filed


17-16 E. 10W

ELWELL-DUWE & FARRIS.
Horojsi No. 1.

SEC. 17 T. 16 R. 10W.
CNL NW SW

Total Depth. 3394
Comm. 7-4-40 Comp. 8-2-40
Shot or Treated.
Contractor.
Issued. 8-24-40

County Ellsworth.

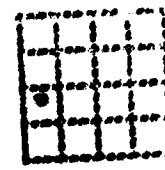

CASING.

10" surface pipe 373' 8"
5 1/2" 3373 1/2'

Elevation.

Production. Pot. 622 B.

Figures Indicate Bottom of Formations.

| | | | |
|---------------------|------|------------------|------|
| shale | 375 | shale | 2702 |
| shale and sand | 500 | lime | 2730 |
| iron and shells | 517 | shale and shells | 2769 |
| shale red | 590 | lime | 2890 |
| shale blue | 610 | shale | 2902 |
| iron | 617 | lime | 2975 |
| shale red | 660 | shale | 3004 |
| iron | 671 | shale sticky | 3047 |
| shale blue and iron | 711 | lime | 3096 |
| anhydrite | 730 | shale | 3107 |
| shale and shells | 1084 | lime | 3371 |
| salt | 1350 | Simpson | 3373 |
| shale and shells | 1430 | lime | 3394 |
| lime | 1482 | Total Depth. | |
| shale | 1498 | | |
| lime | 1642 | Top Arbuckle | 3373 |
| shale and shells | 1680 | Oil 3385-94 | |
| shale and lime | 1717 | | |
| shale and shells | 1802 | | |
| lime broken | 1869 | | |
| lime shale | 1916 | | |
| broken lime | 1971 | | |
| shale and lime | 2046 | | |
| lime broken | 2123 | | |
| shale and shells | 2208 | | |
| lime | 2225 | | |
| shale | 2240 | | |
| lime | 2255 | | |
| shale | 2281 | | |
| shale and shells | 2442 | | |
| shale | 2475 | | |
| lime | 2495 | | |
| shale and lime | 2537 | | |
| shale and shells | 2680 | | |