

STANOLIND OIL AND GAS COMPANY.  
Henry Johnson No. 1.

Plotted Texas CO.

SEC. 21 T. 16 R. 10W  
NE NE SE  
2310 N of S.L. 2310' E of W.L.

NOV 24 1934


Total Depth. 3321 $\frac{1}{2}$   
Comm. 8-26-34 Comp. 10-13-34  
Shot or Treated. 1000 gal acid.  
Contractor.  
Issued. 11-24-34.

Rotary O to 3288  
Cable 3288-3321 $\frac{1}{2}$

CASING.

13" 240' 7" 3287'5"

County. Ellsworth.

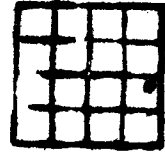

Elevation.

Production. 563 B. Pot.  
Test.

Figures Indicate Bottom of Formations.

|                          |      |
|--------------------------|------|
| shale and shells         | 95   |
| gypsum and shells        | 214  |
| shale and gypsum         | 240  |
| gypsum                   | 299  |
| shale and shells         | 368  |
| shale                    | 493  |
| shale and shells         | 630  |
| shale red                | 645  |
| anhydrite                | 668  |
| red rock                 | 755  |
| shale and lime shells    | 835  |
| shale                    | 930  |
| shale and lime           | 958  |
| shale                    | 980  |
| broken lime              | 995  |
| shale and shells         | 1075 |
| shale blue & lime shells | 1231 |
| shale and salt           | 1345 |
| broken lime              | 1435 |
| lime                     | 1534 |
| lime grey                | 1670 |
| shale                    | 1680 |
| lime                     | 1694 |
| sdv lime                 | 1727 |
| lime grey                | 1731 |
| lime                     | 1878 |
| broken lime              | 2216 |
| shale & lime shells      | 2241 |
| shale blue               | 2285 |
| broken lime              | 2306 |
| shale & lime shells      | 2360 |
| shale blue               | 2405 |
| lime                     | 2445 |
| broken lime              | 2468 |
| shale blue               | 2560 |
| broken lime              | 2700 |
| sdv lime                 | 2777 |
| lime                     | 2798 |
| broken lime & anhyd.     | 2817 |
| lime                     | 2920 |

DRILLED ROTARY

lime 3288

DRILLED CABLE TOOLS

|                   |                    |
|-------------------|--------------------|
| lime              | 3294               |
| red rock and lime | 3311               |
| shale green       | 3316               |
| dolomite          | 3321 $\frac{1}{2}$ |
| Total Depth.      |                    |

Best pay 3318-3321 $\frac{1}{2}$

acidized 1000 gal.  
swabbed 54 bbls in 6 hours before  
treatment.

Potential test 563 bbls in 24 hours.  
10-19-34.

Lansing lime 2997-3294  
Siliceous lime 3316-3321 $\frac{1}{2}$

|              |      |
|--------------|------|
| broken lime  | 2952 |
| shale        | 2985 |
| CORED ROTARY |      |
| shale cored  | 2997 |
| lime cored   | 2999 |
| shale cored  | 3001 |
| lime         | 3003 |
| shale        | 3004 |
| lime         | 3005 |