

Plotted EGC.

WELL LOG BUREAU - KANSAS GEOLOGICAL SOCIETY.  
412 Union National Bank Bldg, Wichita, Kansas.

36-17-11W


SKELLY OIL CO.  
J.B. Bloomer No. 4

SEC. 36 T. 17 R. 11W.  
SE SW NE

Total Depth. 3268  
Comm. 10-18-36 Comp. 11-5-36  
Shot or Treated.  
Contractor. Olson Drlg Co.  
Issued. 1-9-37 Rotary O-3268'

County. Barton.

JAN 9 1937

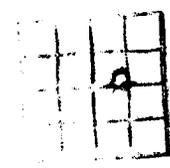

CASING.

10 3/4 189' 7" 3265'

Elevation.

Production. Pot. 2582 B.  
Pumped. Est. 10,000  
Gas.

Figures Indicate Bottom of Formations.

surface soil	10	lime	2735
surface clay and sand	40	lime hard	2846
shale	100	lime	2876
shale and hard shells	130	broken lime	2891
broken lime	189	lime	2921
shale and shells	354	broken lime and shale	2950
red rock	375	lime	2970
shale and red rock	535	broken lime	2977
shale and shells	570	lime	3020
lime	605	lime hard	3053
shale and shells	1350	lime	3149
Bentonite	1390	shale	3158
lime	1505	lime	3260
broken lime	1538	greyish green sh and	
lime hard	1565	grey lime	3265
broken lime	1610	grey and brown porous	
shale	1630	dolomite	3266 Sat.
lime hard	1660	cored 3266 to 3268 Rec 2'	
broken lime	1693	all brown porous dolomite.	
lime	1753	Top Sil lime	3265 SIM
lime hard	1797	dolomite	3268
lime	1922	Total Depth.	
shale	1933		
lime	1990		
broken lime	2024		
lime hard	2050		
broken lime	2136		
lime	2206		
broken lime	2225		
lime	2238		
broken lime	2350		
shale grey	2395		
lime	2445		
broken lime	2466		
lime	2510		
broken lime	2530		
lime	2555		
broken lime	2581		