



Rupe Oil Company

222 Brown Building

Wichita, Kansas 67202

AM 2-3748

BIRZER #1 - SE NE SW of Section 22-17S-12W, Barton County, Kansas

July 9, 1969 - Leveling location and digging pits.

July 10, 1969 - Red Tiger Drilling Contractor moving in Rotary tools and will be setting Surface Casing tomorrow.

Elevation ordered and is being run today by Laughlin-Simmons & Company.

July 11, 1969 - Spudded in at 6:15 p.m. yesterday, and cut 248' of hole. Set 239.53' of 8 5/8" 8 Rd. 20# Range 3 Surface Casing cemented with 175 sacks common cement. Cement circulated. Plug down at 1:00 a.m. today--drilled plug at 7:00 a.m. and at 9:00 a.m. drilling at 435'.

July 12, 1969 - Drilling at 1740'

July 13, 1969 - Drilling at 2330'

July 14, 1969 - Drilling at 2830'

The Anhydrite is 740' to 762' -- elevation is being run today and will know later in the day how the Well is running. Geologist is on the Well.

July 15, 1969 - Drilling at 3055' at 7:00 a.m.

Laughlin-Simmons	elvation	<u>1858'</u>	<u>Kelly Bushing</u>
Heebner	<u>2982'</u>	<u>1856'</u>	<u>Derrick Floor</u>
Brown Lime	<u>3081'</u>		
Lansing	<u>3094'</u>		

At the Lansing level the Well is running 23' high to the key Well (no tests as yet).

A Gas Detector is on the Well.

July 16, 1969 - Drilling at 3258'.

Took Drill Stem Test #1 from 3220' to 3258' - recovered 5' oil speck mud.

Initial Flow pressure	48#
Initial Shut In Pressure	48#
Final Flow pressure	48#
Final Shut In Pressure	48#

July 17, 1969 - Drilled down to 3411' and circulating for samples.

Took Drill Stem Test #2 from 3377' to 3385' -- had weak blow for 12 minutes--recovered 10' drilling mud.


Initial Flow Pressure	24#
Initial Shut In Pressure	1034#
Final Flow Pressure	36#
Final Shut In Pressure	1016#

Top of Arbuckle 3377' or -1519'

The Arbuckle was running 5' higher than the John Evans #1 Birzer.

454
740
118

3084
1954
-1236

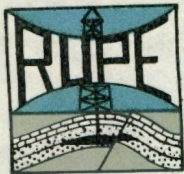

Rupe Oil Company

222 Brown Building

Wichita, Kansas 67202

AM 2-3748

Page 2

BIRZER #1 - SE NE SW of Section 22-17S-12W, Barton County, Kansas

July 18, 1969 - Total Rotary Depth 3411'

Top of the Arbuckle 3377', which was 34' into the Arbuckle and found no porosity or staining. After the second Drill Stem Test decision was made to plug and abandon the Well.

Plugged at 450' with 50 sacks cement,
plugged at 240' with 25 sacks cement, and
plugged at 40' with 10 sacks cement.

The plugging was completed at 8:00 p.m. yesterday.

Sample Tops

HEEBNER	2982'	or	-1124'
BROWM LIME	3081'	or	-1223
LANSING KC	3094'	or	-1236'
ARBUCKLE	3377'	or	-1519'
RTD	3411'	or	-1553'

7/1/69 3
Rig 3 Telephone Manual
of 9/13 ms 5-7954
YP checked
4
5
6
7
8
9
10
11
12
13
14
15
16
17
18
19
20
21
22
23
24
25
26
27
28
29
30
31
32
33
34
35
36
37
38
39
40

Drlg. Contractor: Red Tiger FO 52371
Jean Stocks

Mail to: Paul Divan

- 1 7/3 Elevation ordered by GNR Paul Divan 7/3
- 2 7/3 Intent to Drill by Red Tiger W. K. Stumbaugh 7/3
- 3 7/3 Insurance mailed Wm. Swartz 7/3
- 4 7/8 Red Tiger will correct Intent to read GLEN RUPE & GLENRAY CORPORATION Glenray Corp. 7/3
- 5 7/9 Leveling location and digging pits. G.N. Anger 7/3
- 6 7/10 Red Tiger moving in Rotary tools today and will be setting Surface Csg. tomorrow.
- 7 Elevation is being run today by Laughlin-Simmons
- 8 4:25 p.m. - Called and asked to talk to Jean, but George Angle took call.
- 9 advised Birzer #1 -- had set 297' of Surface Casing and
- 10 they will call BOVARID at Great Bend for Surface Casing--
- 11 Wants to know who in the Field ~~is~~ contact. Rig #3 --
- 12 presently on vacation; however will be starting up this
- 13 week end. *or should Rig #3 case you*
- 14 *at office or home.*
- 15 7/11 Spudded in at 6:15 p.m. yesterday and cut 248' of hole.
- 16 Slope test @ 248' 3 quarters of degree.
- 17 Ran 6 jts. of 8 5/8" 8 Rd. 20# Range 3 New Casing
- 18 Set at 239.53' cemented with 175 sacks common cement.
- 19 Cement circulated. Plug down at 1:00 a.m. -- drilled plug at 7:00 a.m.
- 20 before 9:00 a.m. today drilling at 435'
- 21 Asked Red Tiger's Office to relay to Rig #3 to catch the Anhydrite
- 22 (look for Anhydrite somewhere between 750' to 800')
- 23 Elevation To be run Mon. Lucille with Laughlin-Simmons advised
- 24 Inv. for sure Don was in the area on Wed. (7/9/69) no
- 25 access road nor pits dug; therefore did
- 26 not run elevation. *(rough estimate)*
- 27 Is in Eastern Kansas today. Can make a
- 28 special trip out there, but would put it off
- 29 as long as they could in order to pick up
- 30 other locations in the area.
- 31 Could run Wed. for sure (7/16/69)
- 32 *Manual call 3-2853*
- 33 *will run Monday & Tuesday for sure*
- 34 *at no extra charge than regular*
- 35 7/14 (Saturday July 12th drilling at 1740'.
- 36 Sunday, July 13th drilling at 2330'
- 37 Monday, July 14th drilling at 2830'. Slope test 2042' = 1/2 degree.
- 38 Anhydrite 740 to 762'.
- 39 7/15 Drilling at 3055' at 7:00 a.m. Slope test at 2965' = 1/4 degree. 1856DF

	1	2	3	4
1	7/15	Drilling at 3100 at 10:30 a.m.	Heebner	2982'
2			Brown Line	3081'
3			Lansing	3094'
4		At the Lansing level the Well is running 23' high to the key Well		
5		(Davisson #1 Birzer SW SE SW of 22-17S-12W)		
6		No tests as yet--maybe later on today will take test.		
7		A Gas Detector is on the Well		
8	7/16	Drilling at 3258' -- getting ready to take DST #1 from 3220' to 3258'		
9		noon as per Dick Davis -		
10		<u>DST #1 from 3220 - 3258'</u> - recovered 5' oil speck mud.		
11		All four pressures were 48#.		
12		Back on bottom drilling		
13	7/17	<u>Taking Drill Stem Test #2 from 3358' to 3385' - testing.</u>		
14				
15		Took DST #2 from 3377' to 3385' (weak blow fro 12 min. - Recovered		10'
16		drilling mud. Pressures	ISH	1034#
17			FSH	1016
18			IF	24#
19			FF	36#
20		Top Arbuckle 3377' or 1519'		
21		5' higher than the John Evans #1 Birzer. Samples tight.		
22		Drilled down to 3411' - circulating for samples.		
23	7/18	Rotary Total depth 3411'		
24		Plug a6 450' with 50 sacks cement, plugged at 240' with 25 sacks		
25		cement, plugged at 40' with 10 sacks cement.		
26		Plugging was completed at 8:00 p.m. last night.		
27				
28				
29				
30				
31				
32				
33				
34				
35				
36				
37				
38				
39				
40				

8/13/79 Mr. Sickle/RED TIGER/Otis, Kansas called re #1 BIRZER, Barton County, Kansas SE NE SW of 22-17S-12W

sorry, but he has not been able to handle the following for us; however they drilled the 'dry hole' in '69 as D&A.
We are to contact -
State Plugger, Mr. Dwayne Rankin, Great Bend, Kansas and he knows the story 10 years ago well drilled.

Sickle went by and couldn't find the farmer. He thinks he has a 'sink hole' and probably needs a backhoe to dig it out and put more cement in same.

(Sickle didn't see the location; however thinks after plugging the rathole ground has settled)

8/14/79
John Cecil, Jr.
is handling
same for me
Togey

Thomas Birzer
RED 587-3557
Clatlin Kansas 67525