

**TRILOBITE
TESTING INC.**

P.O. Box 1733 • Hays, Kansas 67601

RECEIVED
SEP 07 2011
BY: _____

Test Ticket

NO. 4424516263

Well Name & No. Potter 'I' #1 Test No. 1 Date 9-5-11
Company Farmer, John D inc Elevation 2489 KB _____ GL _____
Address 370 W Wichita Ave PO Box 352 Russell KS 67654-2635
Co. Rep / Geo. Robert Stolz Jr Rig Discovery #3
Location: Sec. 26 Twp. 17S Rge. 25W Co. NESS State KS

Interval Tested 4280 - 4345 Zone Tested FT Scott
Anchor Length 65' Drill Pipe Run 4240 Mud Wt. 9.1
Top Packer Depth 4275 Drill Collars Run 30.00 Vis 50
Bottom Packer Depth 4280 Wt. Pipe Run 0 WL 8.8
Total Depth 4345 Chlorides 2400 ppm System LCM 1.5#

Blow Description IF: BOB, 24min.

LS: No Return

FF: BOB, 3min.

FS: No Return

Rec	Feet of	%gas	%oil	%water	%mud
<u>450</u>	<u>GIP</u>				
<u>30</u>	<u>BOCM</u>	<u>30</u>	<u>15</u>		<u>55</u>
<u>60</u>	<u>BOCM</u>	<u>5</u>	<u>10</u>		<u>85</u>

Rec Total 90 BHT 117 Gravity _____ API RW _____ @ _____ °F Chlorides _____ ppm

(A) Initial Hydrostatic 2147
(B) First Initial Flow 20
(C) First Final Flow 38
(D) Initial Shut-In 347
(E) Second Initial Flow 54
(F) Second Final Flow 988
(G) Final Shut-In 988
(H) Final Hydrostatic 2082

☒ Test 1225
☒ Jars 250
☒ Safety Joint 75
☐ Circ Sub _____
☐ Hourly Standby _____
☒ Mileage 133 RTE 186.20
☐ Sampler _____
☐ Straddle _____
☐ Shale Packer _____
☐ Extra Packer _____
☐ Extra Recorder _____
☐ Day Standby _____
☐ Accessibility _____
Sub Total 1736.20

T-On Location 0249
T-Started 0428
T-Open 0656
T-Pulled 0956
T-Out 1155
Comments _____


Initial Open 30
Initial Shut-In 30
Final Flow 60
Final Shut-In 60

☐ Ruined Shale Packer _____
☐ Ruined Packer _____
☐ Extra Copies _____
Sub Total 0
Total 1736.20
MP/DST Disc't _____

Approved By _____

Our Representative _____

TriLOBITE TESTING Inc. shall not be liable for damaged or any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

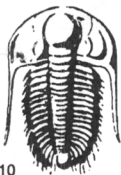

**TRILOBITE
TESTING INC.**

P.O. Box 1733 • Hays, Kansas 67601

RECEIVED
SEP 07 2011

Test Ticket

NO. 44246

Well Name & No. Potter 'I' #1 Test No. 2 Date 9-6-11
 Company FARMER, JOHN D INC Elevation 2489 KB 2481 GL
 Address 370 W. Wichita Ave PO Box 352 Russell KS 67665-2635
 Co. Rep / Geo. Robert Stolze Rig Discovery #3
 Location: Sec. 26 Twp. 17S Rge. 25W Co. NESS State KS

Interval Tested 4360-4440 Zone Tested MISS WARSAW
 Anchor Length 80' Drill Pipe Run 4332 Mud Wt. 9.4
 Top Packer Depth 4360 Drill Collars Run 30 Vis 48
 Bottom Packer Depth 4440 Wt. Pipe Run 0 WL 8.0
 Total Depth 4508' Chlorides 3000 ppm System LCM 2"

Blow Description IF: 6" blow in 20min, 9" in 30min
IS: NO Return
FF: 4" blow in 10min BOB, 34min
FS: Return surface blow died in 20min

Rec	Feet of	%gas	%oil	%water	%mud
<u>175</u>	<u>GIP</u>				
<u>130</u>	<u>CB0</u>	<u>10%</u>	<u>90%</u>		
<u>120</u>	<u>GMCO</u>	<u>10%</u>	<u>50%</u>		<u>40%</u>
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud

Rec Total 250' BHT _____ Gravity _____ API RW _____ @ _____ °F Chlorides _____ ppm

(A) Initial Hydrostatic 2234 ☒ Test 1225' T-On Location 0608
 (B) First Initial Flow 31 ☒ Jars 250' T-Started 0656
 (C) First Final Flow 74 ☒ Safety Joint 75' T-Open 0856
 (D) Initial Shut-In 908 ☐ Circ Sub _____ T-Pulled 12:00
 (E) Second Initial Flow 80 ☐ Hourly Standby _____ T-Out 14:20
 (F) Second Final Flow 120 ☒ Mileage 133RT 186.20 Comments 4min delay trying
 (G) Final Shut-In 879 ☐ Sampler _____ To set slips after
 (H) Final Hydrostatic 2188 ☒ Straddle 600' 1st open

Initial Open 30 ☐ Shale Packer _____ ☐ Ruined Shale Packer _____
 Initial Shut-In 30 ☐ Extra Packer _____ ☐ Ruined Packer _____
 Final Flow 60 ☐ Extra Recorder _____ Sub Total 0
 Final Shut-In 60 ☐ Day Standby _____ Total 2336.20
☐ Accessibility _____ MP/DST Disc't _____
 Sub Total 2336.20

Approved By _____ Our Representative [Signature]

TriLOBITE TESTING Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.