

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

RECEIVED
JUL 21 2011

Test Ticket

NO. 44190 16039
7-18-11

Well Name & No. SKOLAUT #1 Test No. 1 Date 7-17-11
Company mai o'l operations INC Elevation 1983 KB 1975 GL
Address PO Box 33 Russell KS 67465
Co. Rep / Geo. Steve Murphy Rig SOUTH WIND #20
Location: Sec. 33 12 Twp. 18 S Rge. 15 W Co. Barton State KS

Interval Tested 3352 - 3384 Zone Tested E-F+C
Anchor Length 34 Drill Pipe Run 3355 Mud Wt. 9.1
Top Packer Depth 3347 Drill Collars Run 0 Vis 4.5
Bottom Packer Depth 3352 Wt. Pipe Run 0 WL 9.2
Total Depth 3380 Chlorides 3800 ppm System LCM TR


Blow Description FFP- Dead NO Blow
ISI- Dead NO Blow Back
FFP- Dead NO Blow - Flushed Tool Weak Surface Blow Then Died
FSI- Dead NO Blow Back

Rec	Feet of	%gas	%oil	%water	%mud
3	MUD WITH A SCUM OF OIL				

Rec Total 3 BHT 105 Gravity _____ API RW _____ @ _____ °F Chlorides _____ ppm
(A) Initial Hydrostatic 11655 ☒ Test 1125 T-Location 20-39/0-22
(B) First Initial Flow 18 ☐ Jars _____ T-Started 11:07
(C) First Final Flow 19 ☐ Safety Joint _____ T-Open 12:58
(D) Initial Shut-In 27 ☐ Circ Sub _____ T-Pulled 13:58
(E) Second Initial Flow 20 ☐ Hourly Standby _____ T-Out 15:38
(F) Second Final Flow 21 ☒ Mileage 112 RT 156.80 Comments _____
(G) Final Shut-In 27 ☐ Sampler _____
(H) Final Hydrostatic 11642 ☐ Straddle _____


☐ Ruined Shale Packer
☐ Ruined Packer
☐ Extra Copies
Initial Open 15
Initial Shut-In 15
Final Flow 15
Final Shut-In 15
☐ Shale Packer
☐ Extra Packer
☐ Extra Recorder
☐ Day Standby
☐ Accessibility
Sub Total 1281.80
Sub Total 1281.80
MP/DST Disc't _____

Approved By _____ Our Representative Jeff Brown
Trilobite Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

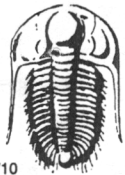

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

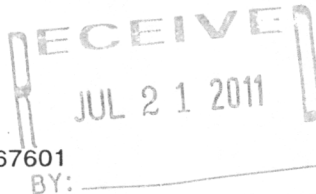

Test Ticket

NO. 44191

Well Name & No. SkolayT #1 Test No. 2 Date 7-19-11
 Company Mai Oil Operations INC Elevation 1983 KB 1975 GL
 Address PO Box 33 Russell KS 67665
 Co. Rep / Geo. Steve Murphy Rig Southwind #26
 Location: Sec. 12 Twp. 18 S Rge. 15 W Co. Barton State KS

Interval Tested 3450-3494 Zone Tested LKC-I-I-K
 Anchor Length 4L Drill Pipe Run 3448 Mud Wt. 9.2
 Top Packer Depth 3445 Drill Collars Run 0 Vis 74
 Bottom Packer Depth 3450 Wt. Pipe Run 0 WL 9.4
 Total Depth 3494 Chlorides 4800 ppm System LCM 0

Blow Description FFP- Fair Blow Built TO 5 1/2 IN
TSI- Dead NO Blow Back
FFP- Fair Blow Built TO 7 3/4 IN
TSI- Dead NO Blow Back

Rec	Feet of	%gas	%oil	%water	%mud
<u>11</u>	<u>OCM</u>	<u>10</u>	<u>10</u>	<u>90</u>	<u>10</u>
<u>20</u>	<u>MC GO</u>	<u>20</u>	<u>70</u>	<u>10</u>	<u>10</u>
<u>136</u>	<u>CoIP</u>				

Rec Total 31 BHT 110 Gravity 21 API RW @ °F Chlorides ppm

(A) Initial Hydrostatic <u>1727</u>	☒ Test <u>1125</u>	T-On Location <u>5:58</u>
(B) First Initial Flow <u>346</u>	☐ Jars	T-Started <u>6:33</u>
(C) First Final Flow <u>39</u>	☐ Safety Joint	T-Open <u>8:04</u>
(D) Initial Shut-In <u>259</u>	☐ Circ Sub	T-Pulled <u>11:04</u>
(E) Second Initial Flow <u>37</u>	☐ Hourly Standby	T-Out <u>12:57</u>
(F) Second Final Flow <u>42</u>	☒ Mileage <u>112 RT 156.80</u>	Comments
(G) Final Shut-In <u>240</u>	☐ Sampler	
(H) Final Hydrostatic <u>1744</u>	☐ Straddle	

Initial Open <u>45</u>	☐ Shale Packer	☐ Ruined Shale Packer
Initial Shut-In <u>45</u>	☐ Extra Packer	☐ Ruined Packer
Final Flow <u>45</u>	☐ Extra Recorder	☐ Extra Copies
Final Shut-In <u>45</u>	☐ Day Standby	Sub Total <u>8</u>
	☐ Accessibility	Total <u>1281.80</u>
	Sub Total <u>1281.80</u>	MP/DST Disc't

Approved By _____ Our Representative Jeff Brown

TriLOBITE TESTING INC. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test, tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.