

TRILOBITE TESTING INC.

P.O. Box 1733 • Hays, Kansas 67601

Test Ticket

NO. 35255

10/08

Well Name & No. Dianne #1-20 Test No. 1 Date 9-21-09
 Company American Warrior, Inc. Elevation 2242 KB 2236 GL
 Address PO Box 399, Garden City, KS. 67846
 Co. Rep / Geo. Jason Alm Rig Petromark #1
 Location: Sec. 1 Twp. 19s Rge. 21w Co. Ness State KS

Interval Tested 4264-4285 Zone Tested Cherokee Sand
 Anchor Length 21' Drill Pipe Run 4135 Mud Wt. 9.2
 Top Packer Depth 4259 Drill Collars Run 121 Vis 47
 Bottom Packer Depth 4264 Wt. Pipe Run 0 WL 9.6
 Total Depth 4285 Chlorides 3.500 ppm System LCM -0-
 Blow Description IFP- Weak Surface Blow
ISI- Dead
FFP- Dead, Pull Tool

Rec	Feet of	%gas	%oil	%water	%mud
<u>2</u>	<u>Mud w/oil specks</u>				
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud
Rec	Feet of	%gas	%oil	%water	%mud

Rec Total 2 BHT _____ Gravity _____ API RW _____ @ _____ °F Chlorides _____ ppm

- (A) Initial Hydrostatic 2083
- (B) First Initial Flow 17
- (C) First Final Flow 18
- (D) Initial Shut-In 67
- (E) Second Initial Flow 18
- (F) Second Final Flow 19
- (G) Final Shut-In ✓
- (H) Final Hydrostatic 2053

- Test
- Jars
- Safety Joint
- Circ Sub
- Hourly Standby
- Mileage
- Sampler
- Straddle
- Shale Packer
- Extra Packer
- Extra Recorder
- Day Standby
- Accessibility

T-On Location 7:24
 T-Started 8:04
 T-Open 10:19
 T-Pulled 11:34
 T-Out 13:05

Comments _____
 Ruined Shale Packer
 Ruined Packer
 Extra Copies
 Sub Total _____
 Total _____

Initial Open 30
 Initial Shut-In 30
 Final Flow 15
 Final Shut-In pull Tool

Approved By _____ Our Representative J. McJannet Thank You
 Trilobite Testing Inc. shall not be liable for damaged of any kind of the property or personnel of the one for whom a test is made, or for any loss suffered or sustained, directly or indirectly, through the use of its equipment, or its statements or opinion concerning the results of any test. tools lost or damaged in the hole shall be paid for at cost by the party for whom the test is made.

RECEIVED
 JAN 25 2010
 OCCWICHTA


Serial #: 8360

Inside

American Warrior, Inc.

1-19s-21w-Nerss

DST Test Number: 1

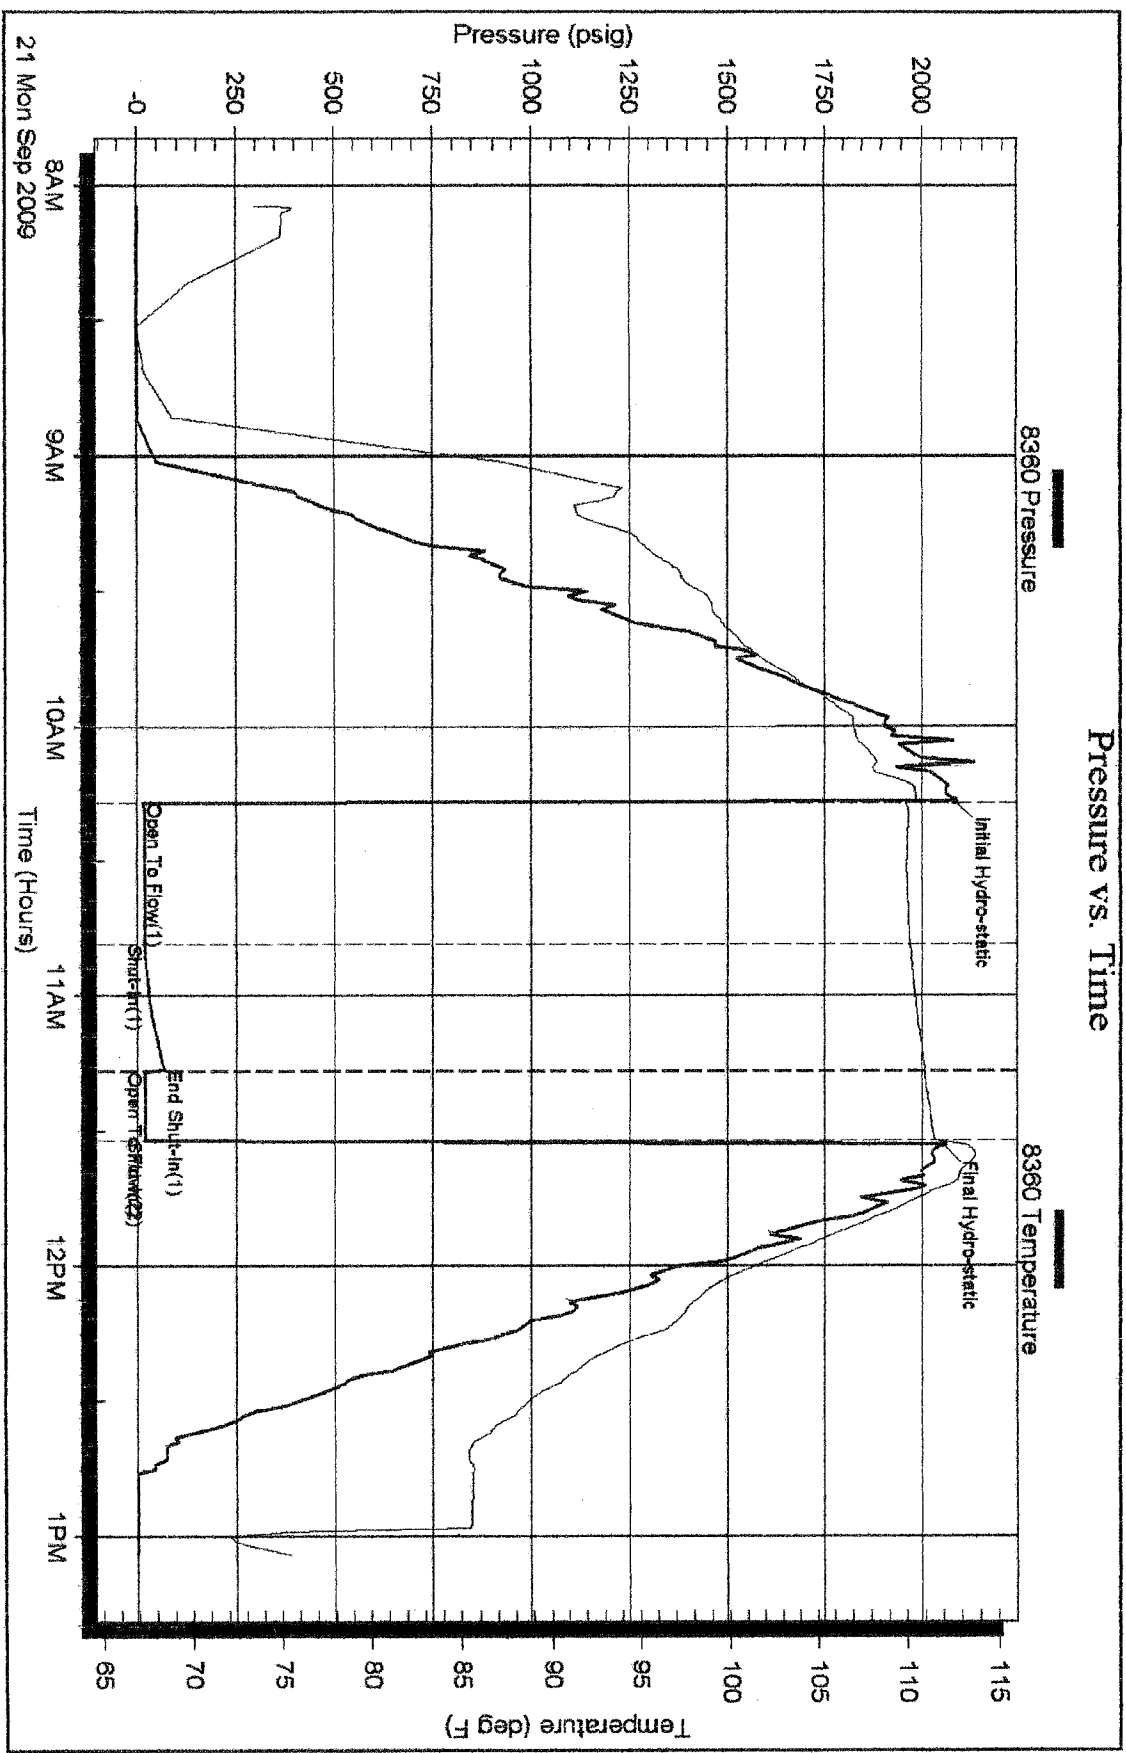

Trilobite Testing, Inc

Ref. No: 36255

Printed: 2009.09.21 @ 13:07:35 Page 2



**TRILOBITE
TESTING, INC.**

DRILL STEM TEST REPORT

American Warrior, Inc.
PO Box 399
Garden City, Ks. 67846
ATTN: Jason Alm


Dianne #1-20
1-19s-21w-Nerss
Job Ticket: 35256 **DST#: 2**
Test Start: 2009.09.21 @ 21:59:09

GENERAL INFORMATION:

Formation: **Mississippi**
Deviated: No Whipstock ft (KB)
Time Tool Opened: 00:53:09
Time Test Ended: 06:05:09
Interval: **4342.00 ft (KB) To 4356.00 ft (KB) (TVD)**
Total Depth: 4356.00 ft (KB) (TVD)
Hole Diameter: 7.80 inches Hole Condition: Good
Test Type: Conventional Bottom Hole
Tester: Jason McLemore
Unit No: 32
Reference Elevations: 2242.00 ft (KB)
2236.00 ft (CF)
KB to GR/CF: 6.00 ft

Serial #: 8360 **Inside**
Press@RunDepth: 95.32 psig @ 4345.00 ft (KB) Capacity: 8000.00 psig
Start Date: 2009.09.21 End Date: 2009.09.22 Last Calib.: 2009.09.22
Start Time: 21:59:09 End Time: 06:05:09 Time On Btrm: 2009.09.22 @ 00:52:39
Time Off Btrm: 2009.09.22 @ 04:03:09

TEST COMMENT: IFF-Good Blow, BOB in 39 Min.
ISI-1/4" Blow back
FFP-Good Blow, BOB in 33 Min.
FSI-Dead

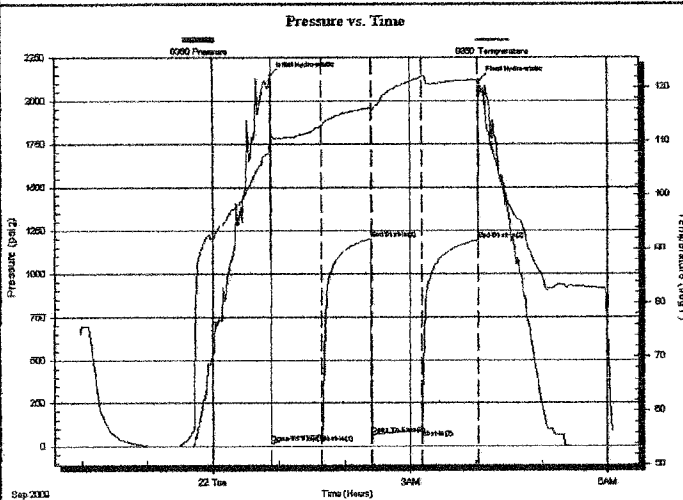

PRESSURE SUMMARY

Time (Min.)	Pressure (psig)	Temp (deg F)	Annotation
0	2147.64	110.97	Initial Hydro-static
1	19.42	110.81	Open To Flow (1)
46	67.40	112.93	Shut-In(1)
91	1200.23	116.22	End Shut-In(1)
92	72.04	115.79	Open To Flow (2)
138	95.32	121.94	Shut-In(2)
189	1193.11	121.41	End Shut-In(2)
191	2119.07	120.49	Final Hydro-static

Recovery

Length (ft)	Description	Volume (bbl)
60.00	OCM-25%O-75%M	0.30
180.00	Clean Oil	1.97
0.00	120' Gas In Pipe	0.00

Gas Rates

	Choke (inches)	Pressure (psig)	Gas Rate (Mcf/d)

Serial #: 8360


Inside

American Warrior, Inc.

1-19s-21w-Nerss

DST Test Number: 2

Pressure vs. Time

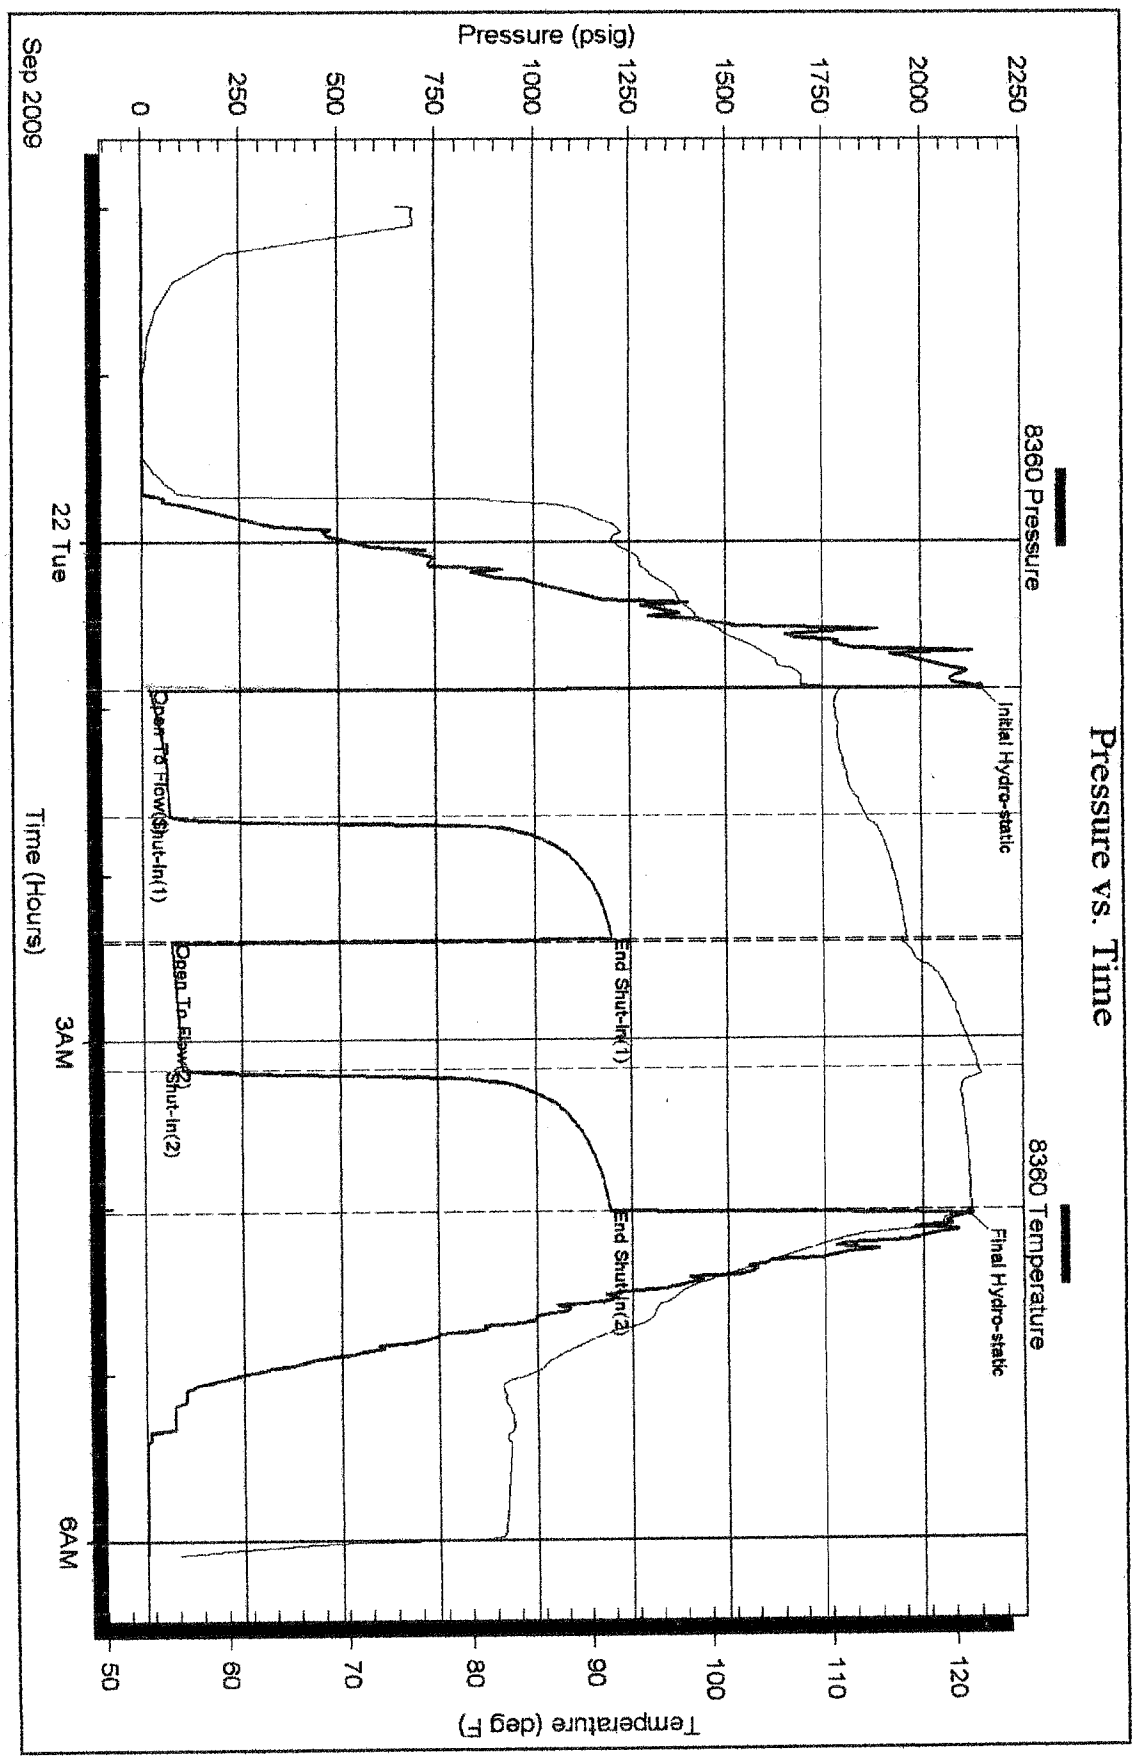

Tribotite Testing, Inc

Ref. No: 35256

Printed: 2009.09.22 @ 06:18:05 Page 2